

## General Information

Date & Time: 09, Jan, 2026 13:58

<b>Make</b>	Toyota	<b>Model</b>	Yaris Cross
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	4,942
<b>Registration No.</b>	GNW1358	<b>Chassis No.</b>	MHFAB8BF3P0012222
<b>CC</b>	1.5	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Hybrid	<b>Type of Body</b>	SUV
<b>Colour</b>	Black		

## Body / Panel Condition



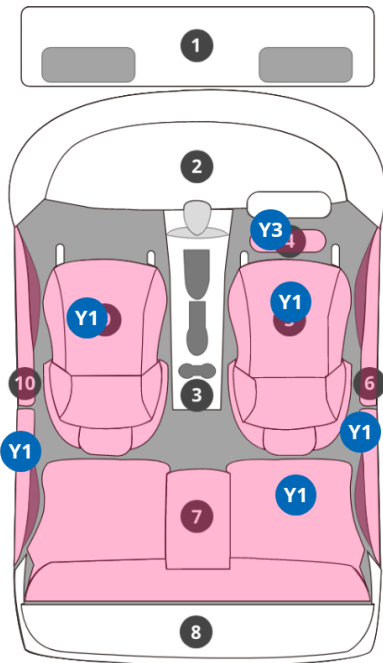
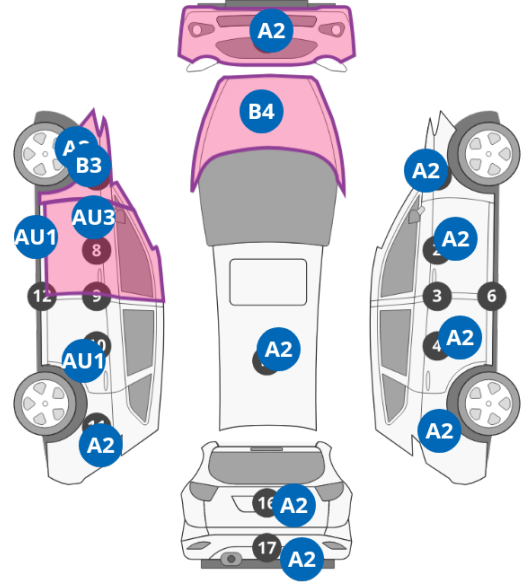
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	36.7	36	38	37
2	Boot Lid	159.0	164	167	146
3	Roof	133.7	156	135	118/126
4	Left Front Fender	43.3	41	41	47
5	Left Front Door	144.3	135	146	152
6	Center Panel Left				
7	Left Rear Door	167.0	178	148	175
8	Left Back Panel	169.3	185	167	156
9	Right Front Fender	143.3	151	150	129
10	Right Front Door	153.0	164	151	144
11	Center Panel Right				
12	Right Rear Door	149.3	150	137	161
13	Right Back Panel	167.3	155	171	176

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Minimal / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Door, Molding - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Modified - Large / (L) Front Fender, Molding - Modified - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with warranty and manual booklet, with reverse camera, no spare key, no spare tire, no tools &amp; jack, scratches on taillight, hood &amp; fender issue.</p>