

General Information

Date & Time: 13, Jan, 2026 15:21

Make	Suzuki	Model	Ertiga
YOM	2024	Odo Meter Reading	23,730
Registration No.	MNV1124	Chassis No.	MHYNC32S4RJ104605
CC	1.5	Transmission	A/T
Fuel Type	Hybrid	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



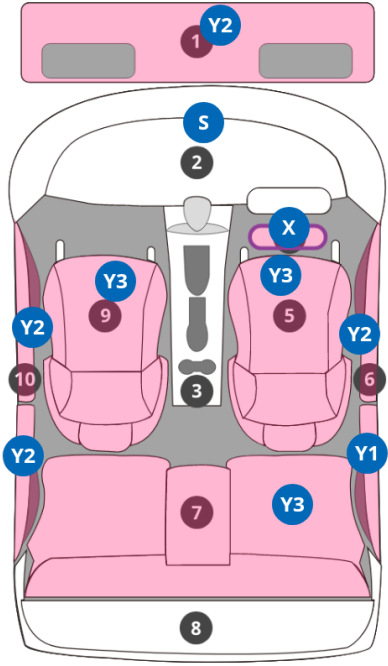
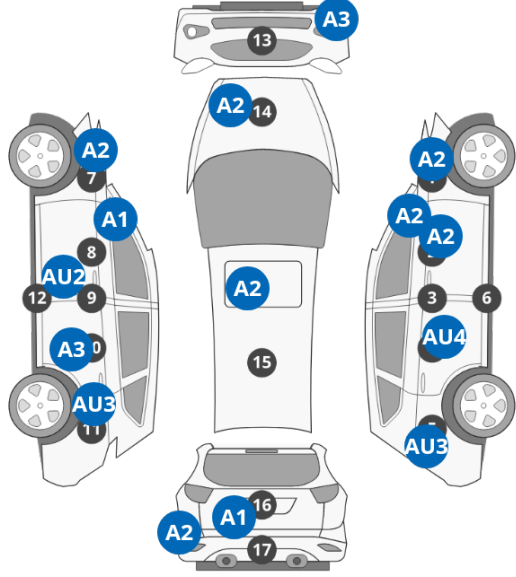
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.8	90	87	98
2	Boot Lid	98.2	87	102	106
3	Roof	87.4	86	95	84/85
4	Left Front Fender	85.4	92	84	81
5	Left Front Door	103.6	110	101	100
6	Center Panel Left				
7	Left Rear Door	106.0	109	104	105
8	Left Back Panel	90.4	103	87	81
9	Right Front Fender	79.3	77	80	82
10	Right Front Door	98.1	103	94	97
11	Center Panel Right				
12	Right Rear Door	100.1	96	93	112
13	Right Back Panel	92.5	92	89	97

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Overall Interior - Smell - Yes / Mat Other - Missing - Yes / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, possible flooding, scratches on headlight and tail light, dome light issue</p>