

## General Information

Date & Time: 16, Jan, 2026 15:42

<b>Make</b>	Mitsubishi	<b>Model</b>	L300
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	13,338
<b>Registration No.</b>	NFM8900	<b>Chassis No.</b>	PAEL65MYSRB025169
<b>CC</b>	2.2	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	FB Body
<b>Colour</b>	White		

## Body / Panel Condition



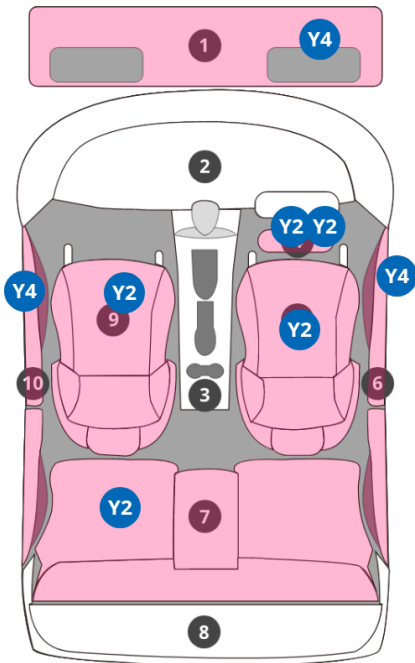
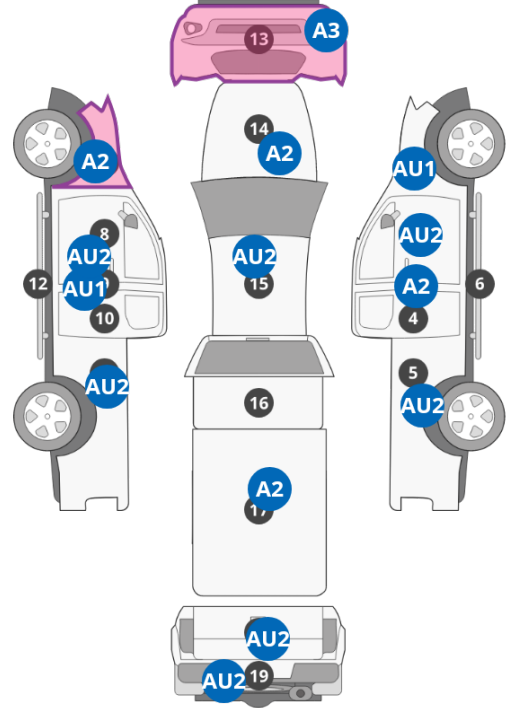
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.3	83	84	107
2	Boot Lid	68.2	75	55	75
3	Roof	71.6	78	72	71/66
4	Left Front Fender	82.1	100	83	63
5	Left Front Door	72.9	75	70	74
6	Center Panel Left	77.8	81	76	77
7	Left Rear Door				
8	Left Back Panel	85.5	79	79	99
9	Right Front Fender	80.8	82	81	80
10	Right Front Door	67.8	73	68	62
11	Center Panel Right	78.8	77	77	83
12	Right Rear Door				
13	Right Back Panel	80.4	65	90	87

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Large / (R) Front Trim - Grime - Large / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Large</p>	<p><b>Remarks</b> (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Center Panel - Scratch - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Minimal / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Side Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Rear Gate - Scratch &amp; Dent - Small / (L) Side Gate - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / Cargo Bed Floor - Scratch - Small / (L) Center Panel - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Small / Front Panel - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire, with jack, no tools, no warranty and manual booklet, scratches on taillight and headlight.</p>