

General Information

Date & Time: 15, Jan, 2026 15:47

Make	Mitsubishi	Model	L300
YOM	2025	Odo Meter Reading	6,237
Registration No.	NKO2032	Chassis No.	PAEL65NUSRB000389
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	FB Body
Colour	White		

Body / Panel Condition



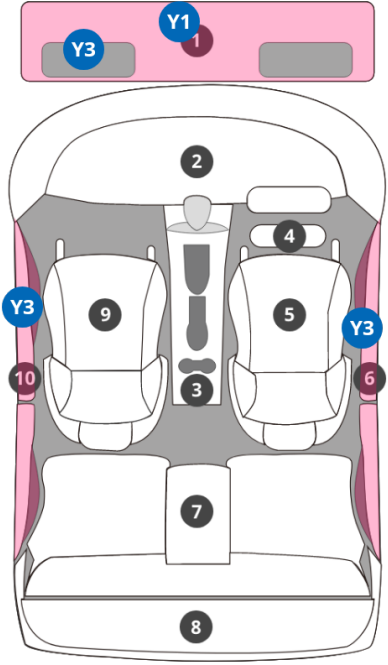
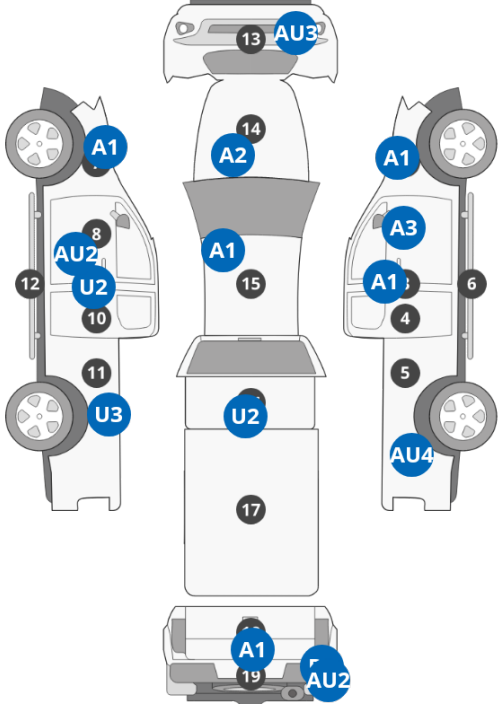
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.2	108	84	115
2	Boot Lid	65.3	65	63	68
3	Roof	106.7	112	112	105/98
4	Left Front Fender	132.0	137	130	129
5	Left Front Door	104.0	107	107	98
6	Center Panel Left	160.6	125	128	229
7	Left Rear Door				
8	Left Back Panel	217.0	391	169	91
9	Right Front Fender	123.3	138	114	118
10	Right Front Door	97.8	102	94	98
11	Center Panel Right	124.0	124	123	125
12	Right Rear Door				
13	Right Back Panel	184.8	242	242	71

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Sunvisor, Sunglass Holder - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Medium / Ceiling - Grime - Minimal</p>	<p>Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Modified - Small / Rear Gate - Scratch - Minimal / Cab Back Panel - Dent - Small / (L) Side Gate - Dent - Medium / (L) Center Panel - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Front Panel - Scratch - Small / Roof - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light</p>