

General Information

Date & Time: 16, Dec, 2025 08:54

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	19,682
Registration No.	DBN3029	Chassis No.	PA1B18F39P4228396
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



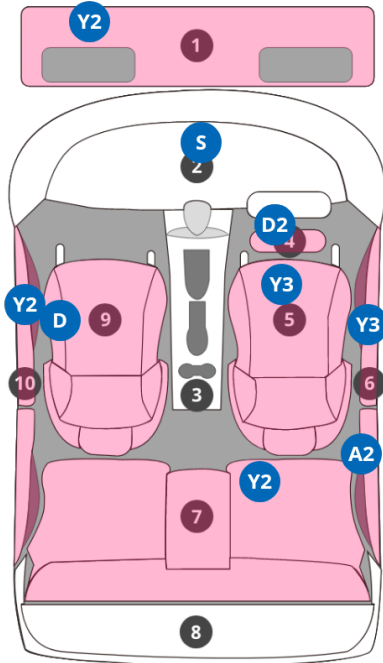
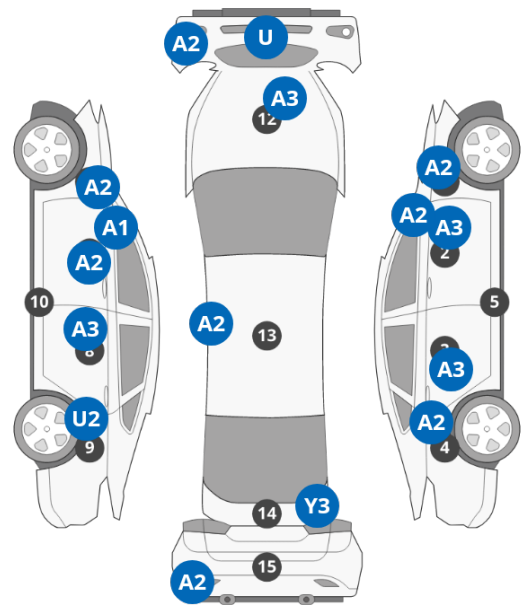
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	118	109	108
2	Boot Lid	123.3	127	124	119
3	Roof	99.5	101	105	98/95
4	Left Front Fender	95.0	95	96	94
5	Left Front Door	95.5	97	98	92
6	Center Panel Left				
7	Left Rear Door	103.0	101	106	102
8	Left Back Panel	181.2	328	135	81
9	Right Front Fender	107.3	111	108	103
10	Right Front Door	95.9	101	90	97
11	Center Panel Right				
12	Right Rear Door	102.3	97	98	112
13	Right Back Panel	151.3	166	142	146

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Ceiling - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Medium / (R) Rear Trim - Cut, Crack - Small</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Medium / (R) Mirror - Scratch - Small / Roof - Scratch - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire and LTO PLATE, possible flooding, scratches on tail light</p>