

## General Information

Date & Time: 27, Jan, 2026 11:00

<b>Make</b>	Suzuki	<b>Model</b>	S-Presso
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	21,955
<b>Registration No.</b>	GBF1659	<b>Chassis No.</b>	MA3FL61SORA466844
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



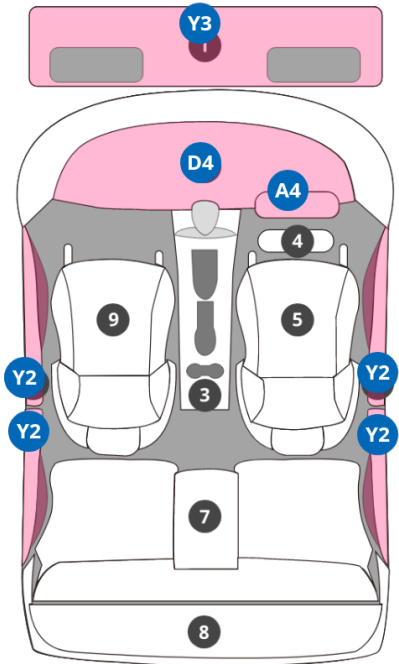
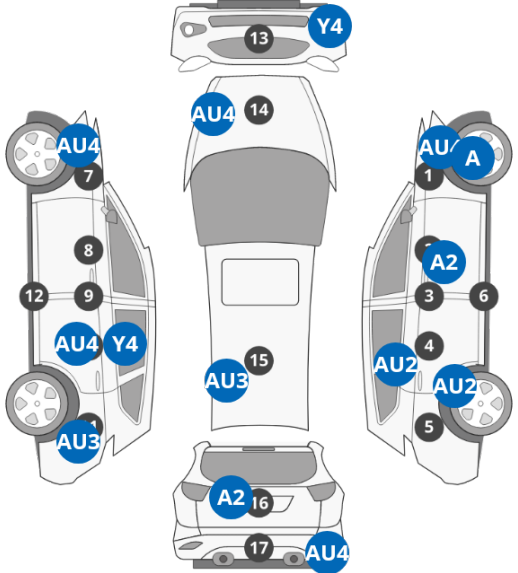
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.3	119	113	114
2	Boot Lid	110.6	111	110	111
3	Roof	137.0	117	218	108/105
4	Left Front Fender	125.6	127	129	121
5	Left Front Door	113.6	114	117	110
6	Center Panel Left				
7	Left Rear Door	107.0	116	104	101
8	Left Back Panel	128.0	128	128	128
9	Right Front Fender	152.3	171	149	137
10	Right Front Door	114.3	112	113	118
11	Center Panel Right				
12	Right Rear Door	105.5	102	100	115
13	Right Back Panel	119.0	121	120	116

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<p><b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span></p>	<p><b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span></p>
<div style="text-align: center;">  </div> <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	<div style="text-align: center;">  </div> <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / Dashboard - Worked - Large / Steering Wheel - Worn, Peel, Crack - Large</p>	<p><b>Remarks</b> Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch &amp; Dent - Large / (L) Front Fender, Molding - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Side Window - Damaged - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / Roof - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Front Tyre - Crack, Cut - Yes</p>
<p><b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">D</span></p>	<p><b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span></p>
<p><b>Remarks</b> Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key &amp; Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

Non moving salvage unit. Damaged front bumper, front right fender and bonnet. Damaged rear left window. Damaged Front right tire. Flooded unit. Rear door both side opening issue. Without warranty booklet, jack and tools. With spars tire and seat cover. 1 key. With LTO plate.