

## General Information

Date & Time: 16, Dec, 2025 13:14

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	40,795
<b>Registration No.</b>	NIT9414	<b>Chassis No.</b>	PA1B18F34P4229505
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



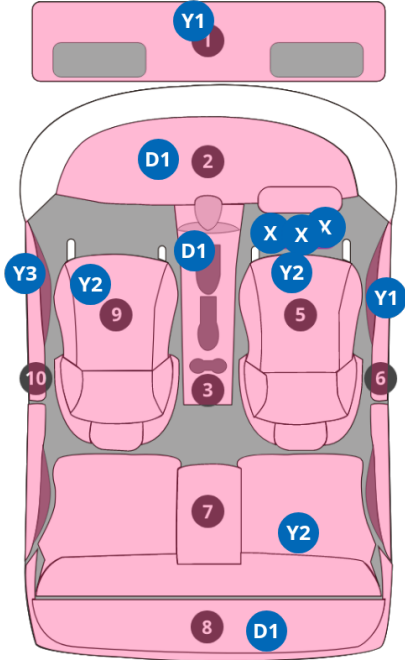
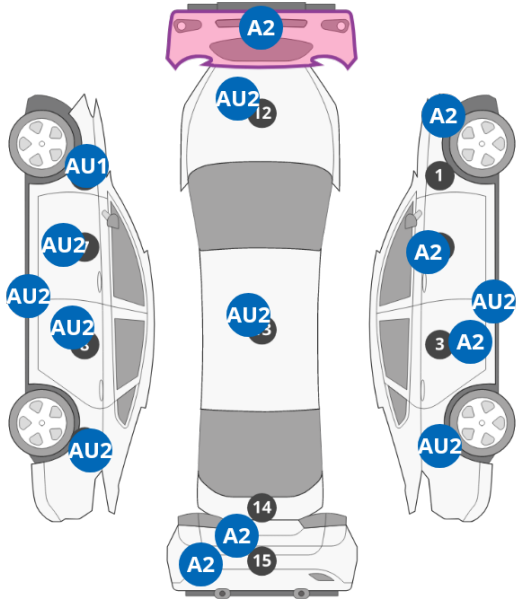
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.4	98	108	122
2	Boot Lid	107.6	103	114	106
3	Roof	133.7	218	102	123/92
4	Left Front Fender	102.0	101	100	105
5	Left Front Door	107.6	108	100	115
6	Center Panel Left				
7	Left Rear Door	110.9	121	99	113
8	Left Back Panel	114.0	120	107	115
9	Right Front Fender	105.0	107	100	108
10	Right Front Door	107.0	111	105	105
11	Center Panel Right				
12	Right Rear Door	109.6	107	118	104
13	Right Back Panel	107.9	97	108	119

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>D</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Minimal / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Minimal / Console, Switches, Vents - Worked - Minimal / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal / Dashboard - Worked - Minimal</p>	<p><b>Remarks</b> Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with manual &amp; warranty booklet, no spare key, no spare tire, no tools &amp; jack, no reverse camera, scratches on taillight, irregular VS form/MMDA violation attended driver.</p>