

General Information

Date & Time: 17, Dec, 2025 09:28

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	108,810
Registration No.	NFH4759	Chassis No.	PA1B18F32N4172850
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



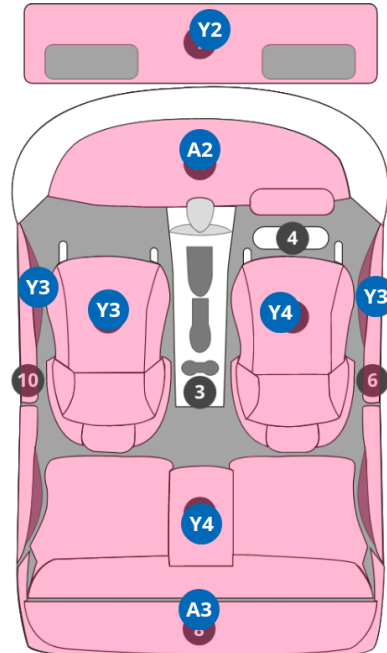
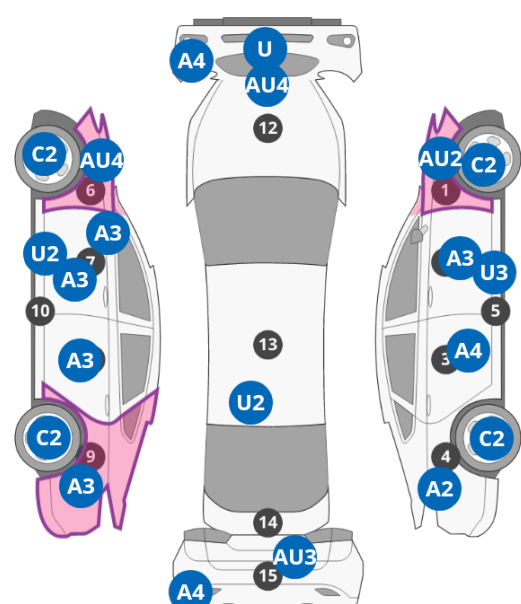
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	109	101	104
2	Boot Lid	128.6	169	106	111
3	Roof	99.8	101	95	103/100
4	Left Front Fender	625.0	930	541	404
5	Left Front Door	106.6	110	102	108
6	Center Panel Left				
7	Left Rear Door	137.0	131	122	158
8	Left Back Panel	445.0	646	425	264
9	Right Front Fender	265.0	175	502	118
10	Right Front Door	167.3	183	149	170
11	Center Panel Right				
12	Right Rear Door	142.6	142	122	164
13	Right Back Panel	114.3	121	109	113

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Mirror - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Roof - Dent - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

with LTO plate/with spare tire/with 1 spare key/No reverse camera/No warranty booklet/left side mirror issue/with jack and incomplete tools/park lights issue/plate light issue/No fog light/engine noise vibration