

General Information

Date & Time: 16, Dec, 2025 20:18

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	53,720
Registration No.	NFC9365-1	Chassis No.	MHFA1BYXP0016800
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	Red Mica Metallic		

Body / Panel Condition



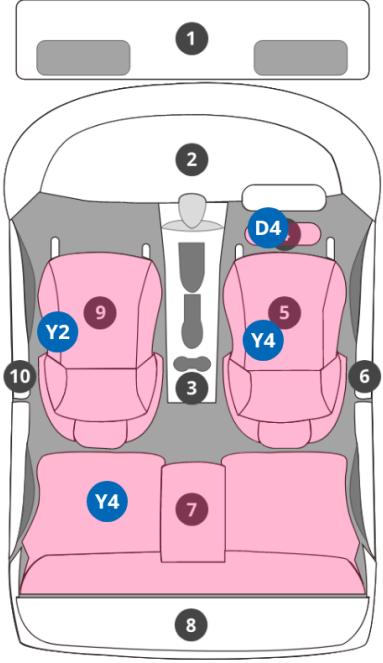
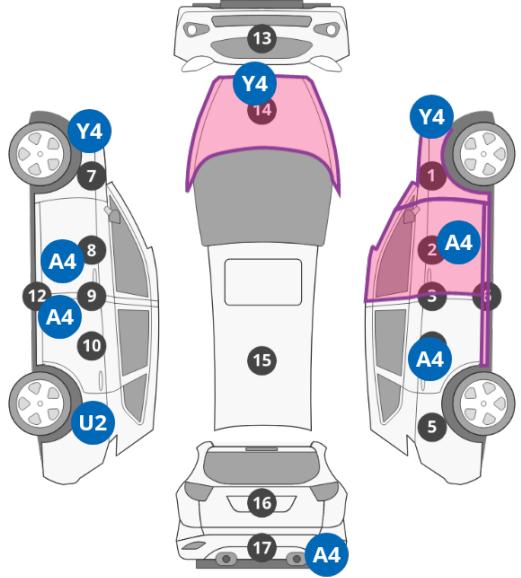
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	170.3	204	188	119
2	Boot Lid	112.6	126	104	108
3	Roof	113.5	108	118	115/113
4	Left Front Fender	121.0	121	124	118
5	Left Front Door	114.3	107	127	109
6	Center Panel Left				
7	Left Rear Door	103.0	104	106	99
8	Left Back Panel	106.6	110	104	106
9	Right Front Fender	229.3	285	189	214
10	Right Front Door	345.6	189	376	472
11	Center Panel Right				
12	Right Rear Door	138.6	138	133	145
13	Right Back Panel	110.6	107	105	120

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Large / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Small / Rear Seat - Grime - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Crack, Gap - Large / (L) Front Fender, Molding - Crack, Gap - Large / Bonnet, Headlight - Crack, Gap - Large / (L) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large</p>
Frame Evaluation : D	Functional Evaluation : C
<p>Remarks Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ no jack and tools/ with spare tire/ possible flooding/ with LTO plate/ radio issue/ maintenance warning lamp on/ remote key issue/</p>