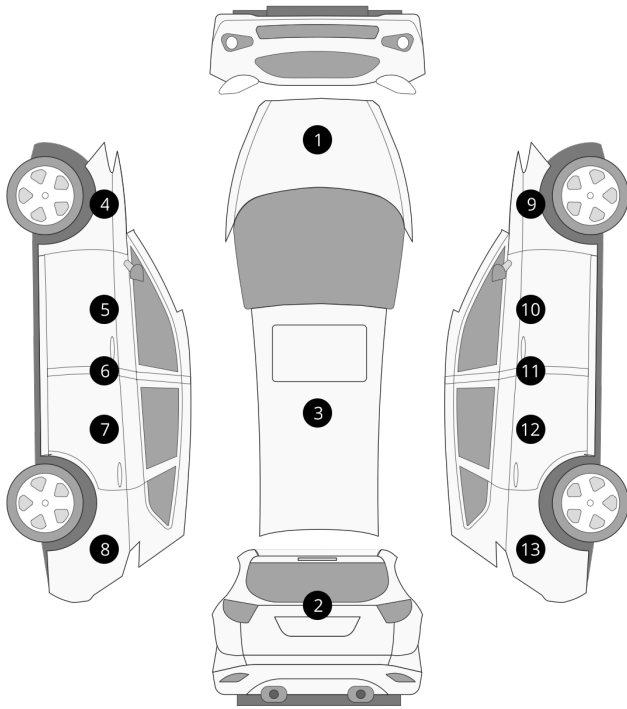


## General Information

Date & Time: 05, Jan, 2026 13:27

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	32,626
<b>Registration No.</b>	DBP3742	<b>Chassis No.</b>	PA1B18F32R4262716
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



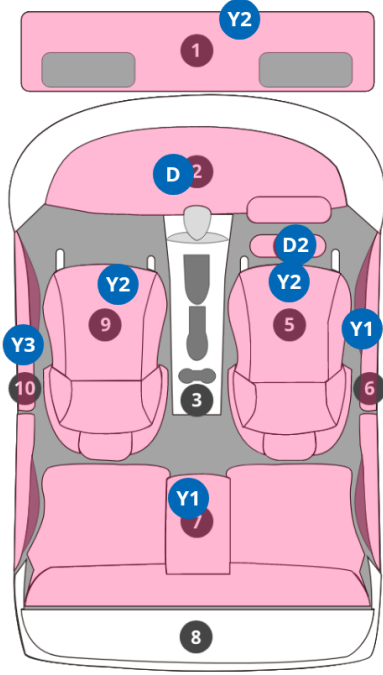
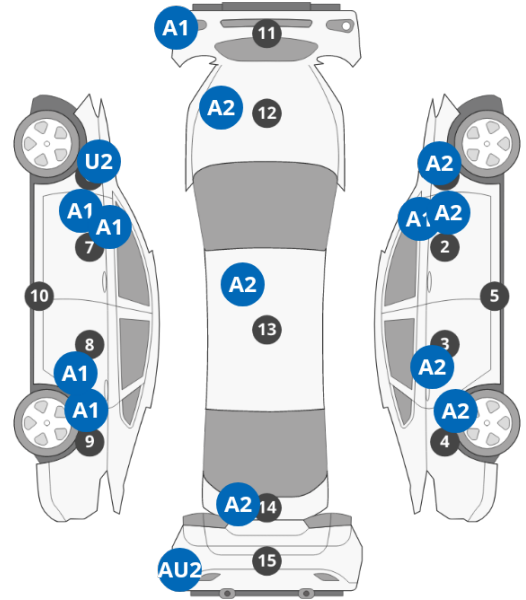
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>117.3</b>	121	106	125
2	Boot Lid	<b>113.6</b>	110	115	116
3	Roof	<b>110.2</b>	115	108	103/115
4	Left Front Fender	<b>105.3</b>	106	105	105
5	Left Front Door	<b>100.5</b>	98	100	104
6	Center Panel Left				
7	Left Rear Door	<b>103.0</b>	118	103	88
8	Left Back Panel	<b>115.6</b>	122	117	108
9	Right Front Fender	<b>100.7</b>	97	100	105
10	Right Front Door	<b>105.3</b>	101	111	104
11	Center Panel Right				
12	Right Rear Door	<b>108.0</b>	107	104	113
13	Right Back Panel	<b>111.0</b>	111	110	112

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Trim - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, check engine indicators ON, traction control indicator ON</p>