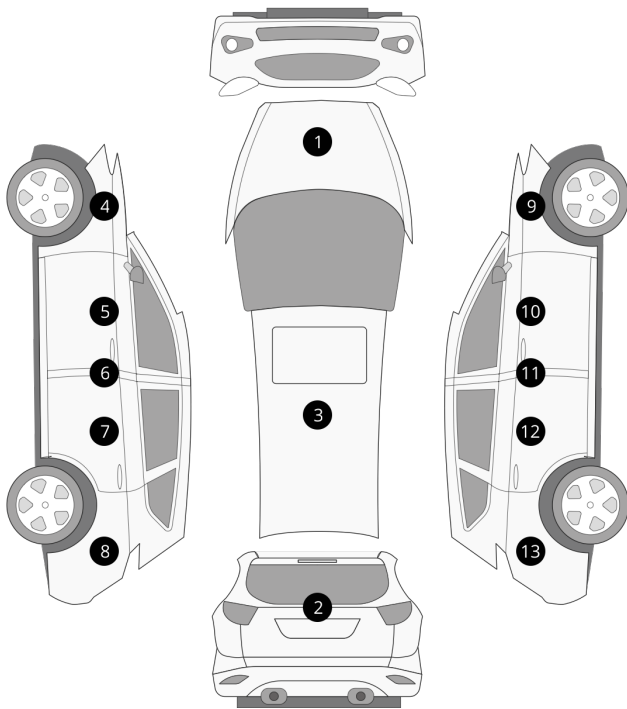


General Information

Date & Time: 20, Dec, 2025 09:54

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,137
Registration No.	NHS9416	Chassis No.	PA1B18F36R4270706
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



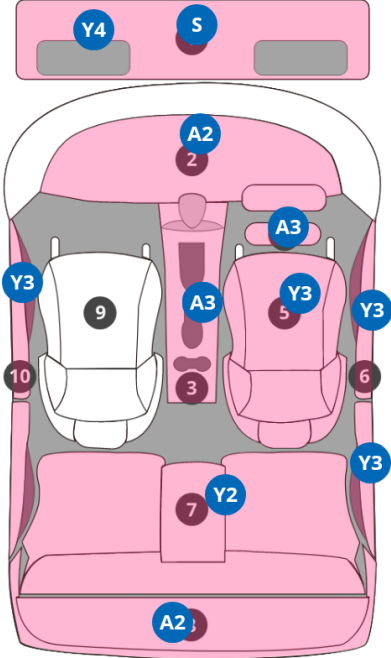
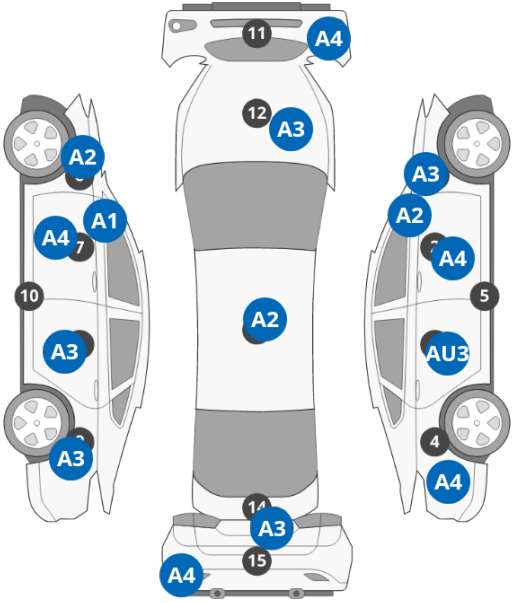
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.5	119	97	107
2	Boot Lid	96.8	89	97	105
3	Roof	89.5	91	93	86/89
4	Left Front Fender	99.7	97	97	106
5	Left Front Door	99.3	98	100	100
6	Center Panel Left				
7	Left Rear Door	106.0	110	107	101
8	Left Back Panel	104.1	105	99	108
9	Right Front Fender	96.6	112	86	92
10	Right Front Door	93.4	90	91	99
11	Center Panel Right				
12	Right Rear Door	95.3	100	93	94
13	Right Back Panel	95.2	88	92	106

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / Ceiling - Grime - Large / Knobs - Worn, Peel, Crack - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Overall Interior - Smell - Yes</p>	<p>Remarks (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Shift Shock - Function - Weak / Battery - Weak - Yes / Seat Belts - Issue - Yes</p>

<p>Inspector Notes</p>
<p>LTO plate not original/with spare tire/with 2 spare key/with reverse camera/with jack and incomplete tools/cheek light issue/trunk hood issue/possible flooding/with warranty booklet/shift shock issue//interior dirty/</p>