

## General Information

Date & Time: 06, Jan, 2026 08:47

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	17,976
<b>Registration No.</b>	NHU3854	<b>Chassis No.</b>	PA1B18F3XR4268540
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



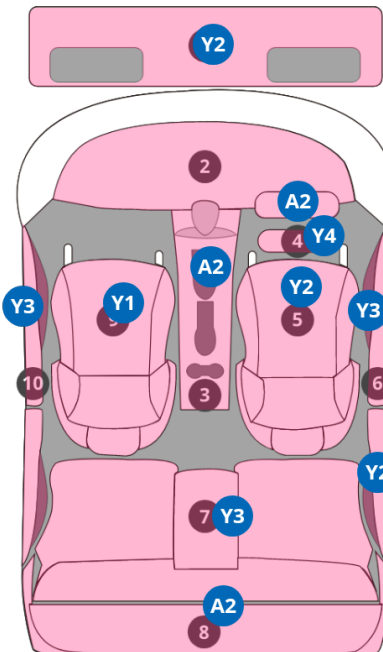
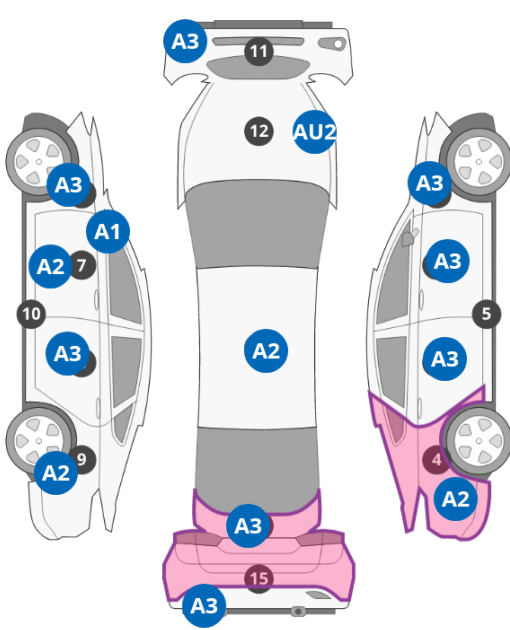
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.6	145	105	121
2	Boot Lid	342.0	435	206	385
3	Roof	97.3	103	97	99/90
4	Left Front Fender	101.6	101	102	102
5	Left Front Door	101.8	99	109	98
6	Center Panel Left				
7	Left Rear Door	101.3	105	102	97
8	Left Back Panel	127.0	132	123	126
9	Right Front Fender	108.6	102	99	125
10	Right Front Door	101.0	103	100	100
11	Center Panel Right				
12	Right Rear Door	98.8	96	104	97
13	Right Back Panel	317.0	192	140	619

Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Large / (L) Front Seat - Grime - Minimal / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small	<b>Remarks</b> Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / Roof - Scratch - Small
<b>Frame Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<b>Remarks</b> Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes	<b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
with LTO plate/with spare tire/with jack and incomplete tools/No spare key/with reverse camera/No warranty booklet/cheek light issue/rear door partial parts missing/