

General Information

Date & Time: 20, Dec, 2025 09:48

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	37,280
Registration No.	DBG5629	Chassis No.	MHKA4DF5FNJ077143
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Yellow		

Body / Panel Condition



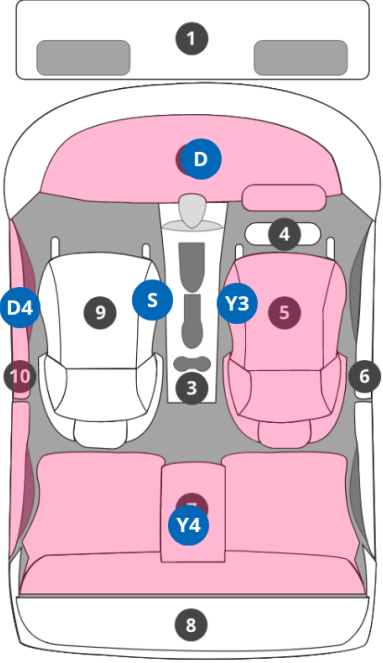
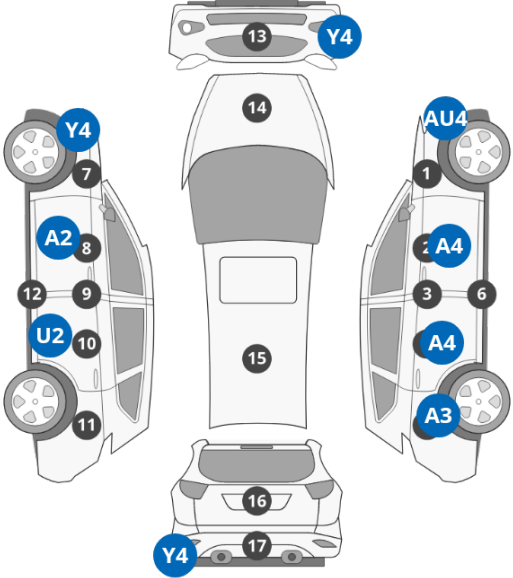
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	225.0	308	240	127
2	Boot Lid	111.0	104	117	112
3	Roof	100.5	92	112	100/98
4	Left Front Fender	135.0	139	148	118
5	Left Front Door	113.0	115	119	105
6	Center Panel Left				
7	Left Rear Door	109.3	106	110	112
8	Left Back Panel	107.3	113	108	101
9	Right Front Fender	109.0	117	109	101
10	Right Front Door	106.0	103	108	107
11	Center Panel Right				
12	Right Rear Door	105.0	108	106	101
13	Right Back Panel	105.0	112	101	102

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / (L) Front Trim - Worked - Large / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Bonnet - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Crack, Gap - Large</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes
scratch on headlight/ possible flooding/ cracked tail light/ reverse camera issue/ no jack, and tools/ with LTO plate and warranty booklet / with spare tire/