

General Information

Date & Time: 17, Dec, 2025 18:21

Make	Mitsubishi	Model	Strada
YOM	2017	Odo Meter Reading	142,169
Registration No.	NBY5916	Chassis No.	MMBJJKL10HH030476
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



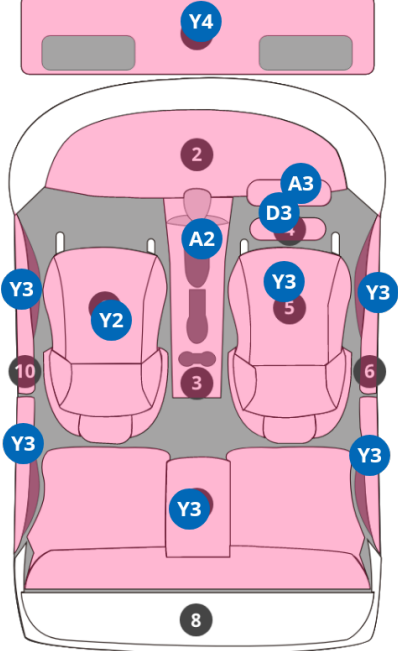
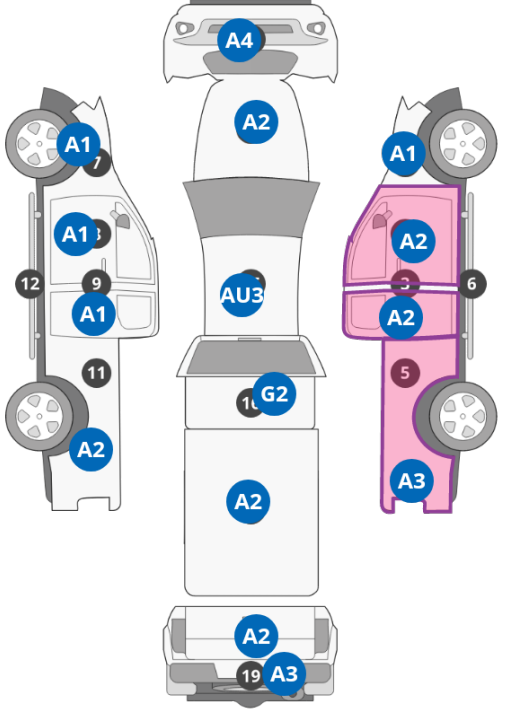
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.3	119	111	116
2	Boot Lid	393.0	325	279	575
3	Roof	109.3	99	100	110/129
4	Left Front Fender	104.3	103	101	109
5	Left Front Door	199.0	197	178	222
6	Center Panel Left	137.6	86	81	246
7	Left Rear Door	161.0	176	154	153
8	Left Back Panel	454.3	383	287	693
9	Right Front Fender	179.0	189	202	146
10	Right Front Door	360.3	368	423	290
11	Center Panel Right	116.6	101	143	106
12	Right Rear Door	429.6	574	318	397
13	Right Back Panel	423.3	706	282	282

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Crinkle - Medium / Steering Wheel - Worn, Peel, Crack - Medium / Ceiling - Grime - Large / Knobs - Worn, Peel, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Center Panel - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Side Gate - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Side Gate - Scratch - Small / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch & Dent - Medium / Rear Windshield - Scratch, Stone chip - Small / Cargo Bed Floor - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/No jack and tools reverse camera issue/front bumper partial parts missing/with warranty booklet/Interior dirty