

## General Information

Date & Time: 05, Jan, 2026 13:28

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	40,316
<b>Registration No.</b>	DBO1837	<b>Chassis No.</b>	PA1B18F30P4237469
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



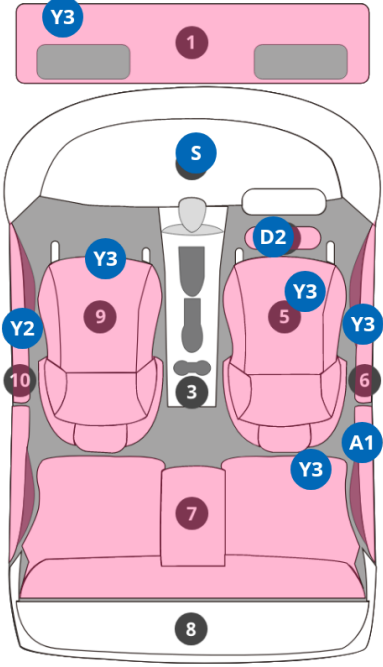
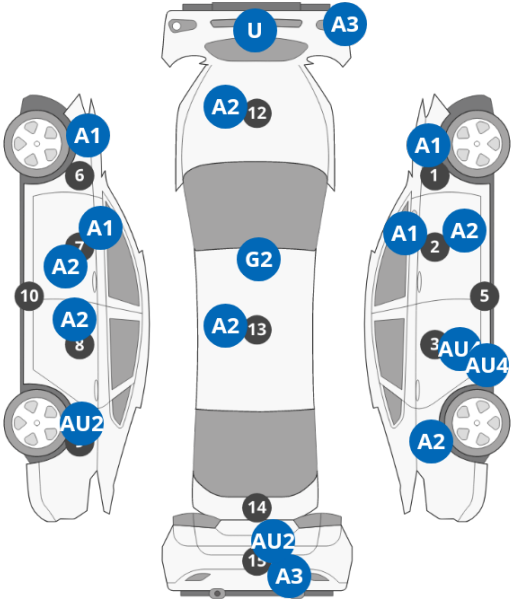
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>124.3</b>	120	112	141
2	Boot Lid	<b>113.7</b>	110	133	98
3	Roof	<b>105.7</b>	101	118	98/106
4	Left Front Fender	<b>100.3</b>	101	101	99
5	Left Front Door	<b>99.2</b>	96	104	98
6	Center Panel Left				
7	Left Rear Door	<b>104.0</b>	109	103	100
8	Left Back Panel	<b>103.3</b>	108	101	101
9	Right Front Fender	<b>107.3</b>	107	113	102
10	Right Front Door	<b>102.6</b>	106	100	102
11	Center Panel Right				
12	Right Rear Door	<b>106.9</b>	111	100	110
13	Right Back Panel	<b>104.3</b>	108	101	104

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / Mat Other - Worked - Small / (L) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Trim - Grime - Medium</p>	<p><b>Remarks</b> Front Windshield - Scratch, Stone chip - Small / Member (Bolted) - Dent - Yes / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>	
<p>no warranty booklet, with jack and tools, with spare tire, no LTO plate, scratches on tail light</p>	