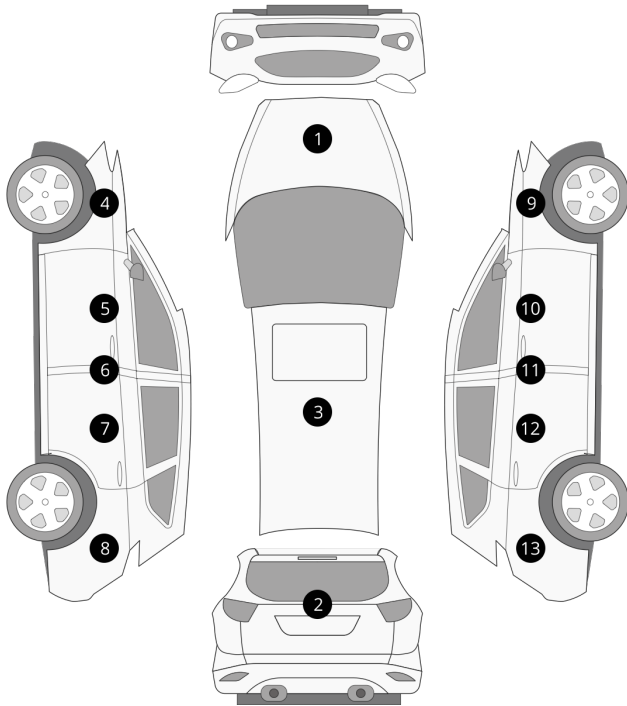


General Information

Date & Time: 20, Feb, 2026 15:52

Make	Toyota	Model	Hiace
YOM	2022	Odo Meter Reading	284,693
Registration No.	EAF2568 - NON - MOVING	Chassis No.	JTFNAFAP0N8024381
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



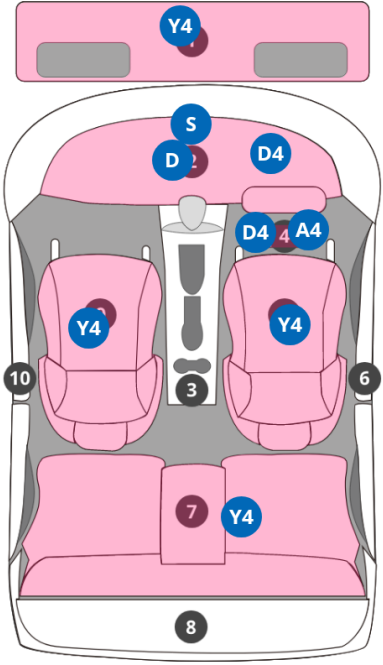
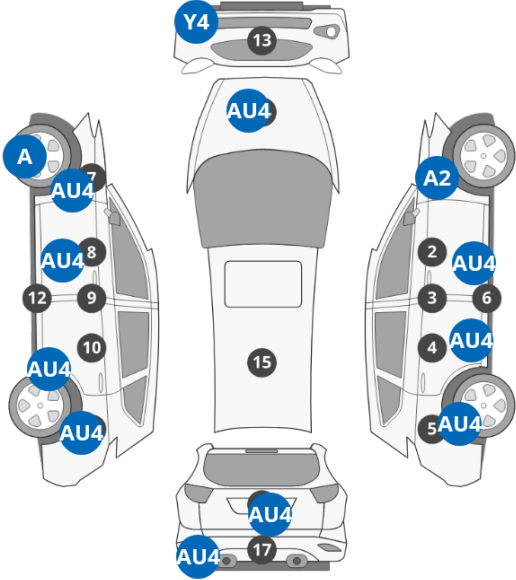
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	117	122	123
2	Boot Lid	269.3	206	206	396
3	Roof	132.5	123	184	118/105
4	Left Front Fender	96.0	96	96	96
5	Left Front Door	122.6	129	115	124
6	Center Panel Left				
7	Left Rear Door	120.3	124	122	115
8	Left Back Panel	283.3	171	369	310
9	Right Front Fender	120.0	119	118	123
10	Right Front Door	93.8	93	96	93
11	Center Panel Right				
12	Right Rear Door	95.2	100	93	93
13	Right Back Panel	100.8	105	100	98

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is". This report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / Rear Seat - Grime - Large / Ceiling - Grime - Large / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / Dashboard - Loose, Deformed - Large / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Large / Carpet - Worn, Scratch, Cut, Crack - Large</p>	<p>Remarks (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Tyre - Crack, Cut - Yes / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Large</p>
Frame Evaluation : C	Functional Evaluation : E
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p> <p>- Irregular VS form/HPG RECOVER/LTO apprehension failure carry driver license - non-moving, tire damage/ no jack and tools/ no spare tire/ no warranty booklet/ possible flooding/ with LTO plate</p>
--