

General Information

Date & Time: 06, Jan, 2026 13:29

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	34,681
Registration No.	NJF1086	Chassis No.	MHFAA1BY4R0033420
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



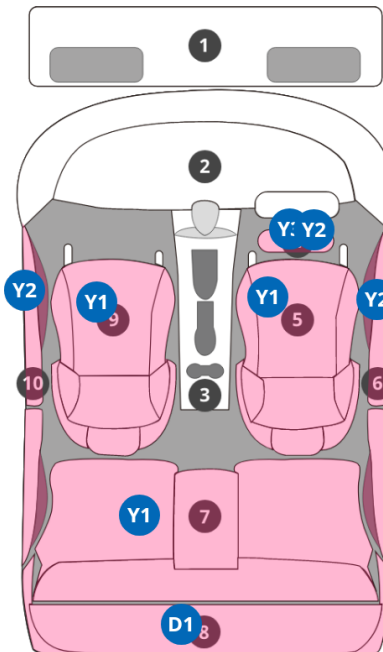
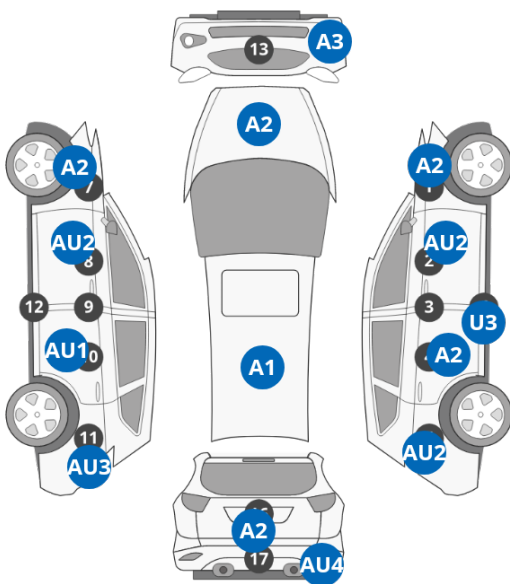
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.4	108	93	106
2	Boot Lid	113.3	122	111	107
3	Roof	135.2	183	125	126/107
4	Left Front Fender	106.6	108	103	109
5	Left Front Door	115.6	110	114	123
6	Center Panel Left				
7	Left Rear Door	115.3	111	104	131
8	Left Back Panel	134.0	140	115	147
9	Right Front Fender	107.5	111	119	93
10	Right Front Door	113.0	118	116	105
11	Center Panel Right				
12	Right Rear Door	113.3	116	108	116
13	Right Back Panel	114.6	120	103	121

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / Trunk Room - Worked - Minimal	Remarks (L) Step - Repair Traces - Yes / Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Dent - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with Manual & warranty booklet, with reverse camera, with spare tire, no tools & jack, no spare key, scratches on taillight.