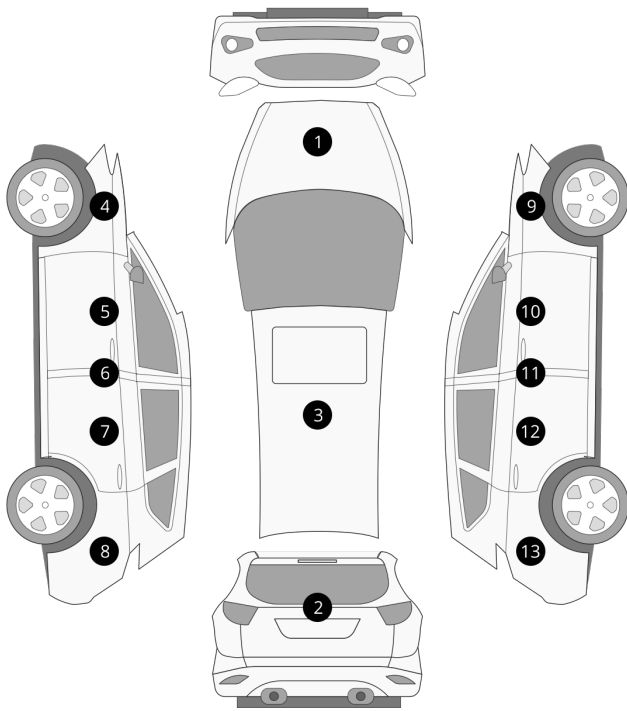


General Information

Date & Time: 20, Dec, 2025 14:50

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	3,228
Registration No.	CCG7299	Chassis No.	MHFAA1BY5S0038583
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



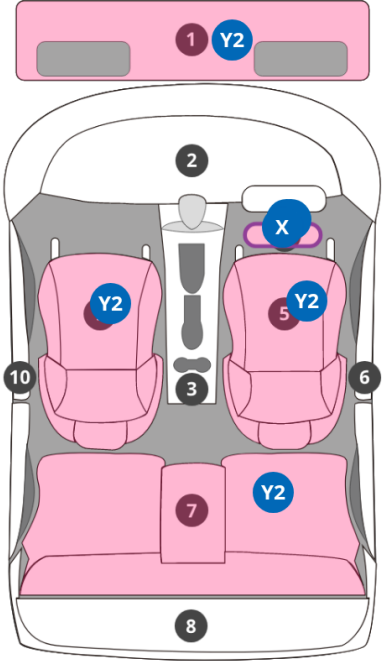
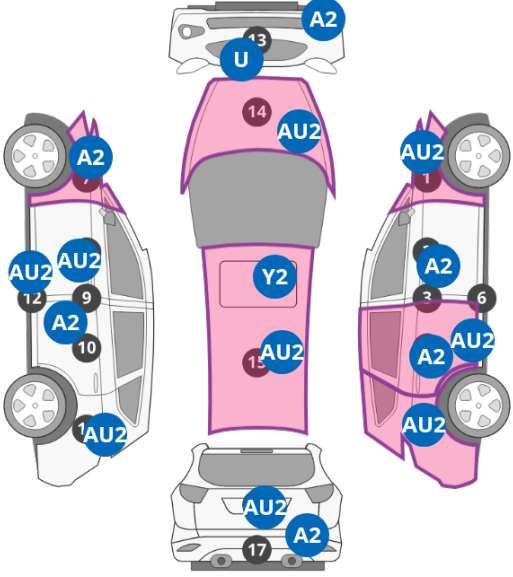
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.2	118	99	135
2	Boot Lid	109.6	113	111	105
3	Roof	216.0	160	307	148/249
4	Left Front Fender	96.7	99	93	99
5	Left Front Door	119.0	113	118	126
6	Center Panel Left				
7	Left Rear Door	110.6	113	107	112
8	Left Back Panel	117.3	116	129	107
9	Right Front Fender	160.3	155	179	147
10	Right Front Door	82.5	86	78	84
11	Center Panel Right				
12	Right Rear Door	117.0	111	114	126
13	Right Back Panel	182.3	163	196	188

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / Roof - Repair Traces - Yes / Roof - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Windshield - Damaged - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small
Frame Evaluation : B	Functional Evaluation : D
Remarks Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Parking Brake - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Jack, No Tools and warranty booklet, No spare key, Abnormal vibration, Abnormal shiftshock, scratch and crack tail light and headlight, worn tires, foul smell, Plate light and Room light issue, air-conditioned issue.