

General Information

Date & Time: 29, Dec, 2025 14:13

| | | | |
|-------------------------|-------------------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2023 | Odo Meter Reading | 29,581 |
| Registration No. | CBI1516 | Chassis No. | PA1B18F38P4208690 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Blackish Red Mica | | |

Body / Panel Condition



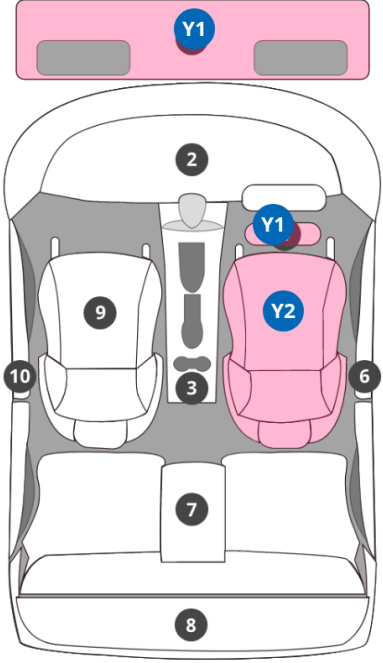
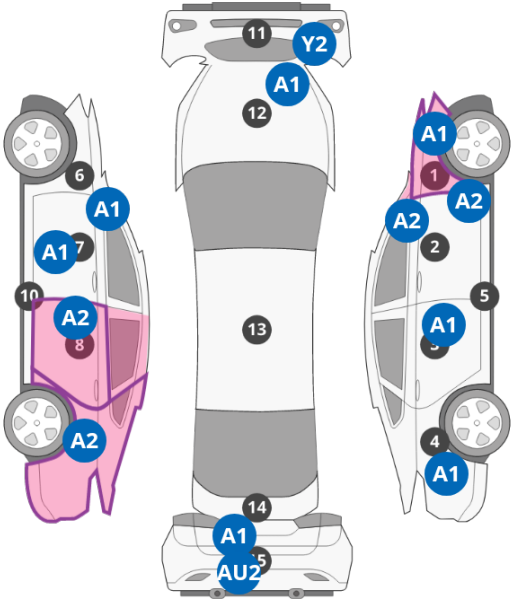
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 107.6 | 119 | 102 | 102 |
| 2 | Boot Lid | 110.3 | 114 | 105 | 112 |
| 3 | Roof | 99.1 | 102 | 97 | 91/106 |
| 4 | Left Front Fender | 97.6 | 96 | 100 | 98 |
| 5 | Left Front Door | 93.0 | 89 | 94 | 97 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 116.1 | 106 | 92 | 150 |
| 8 | Left Back Panel | 272.3 | 520 | 156 | 141 |
| 9 | Right Front Fender | 165.6 | 181 | 157 | 159 |
| 10 | Right Front Door | 97.6 | 103 | 93 | 97 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 107.7 | 98 | 107 | 118 |
| 13 | Right Back Panel | 104.8 | 105 | 99 | 110 |

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|--|--|
| Interior Evaluation : A | Exterior Evaluation : C |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks (R) Front Seat - Grime - Small / Ceiling - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal</p> | <p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Small / Bonnet, Headlight - Scratch - Minimal</p> |
| Frame Evaluation : A | Functional Evaluation : A |
| <p>Remarks Defects not found</p> | <p>Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes</p> |

| |
|--|
| <p>Inspector Notes</p> |
| <p>No Lto plate, with warranty booklet, with jack, no spare tire and tools, 2keys, scratches on headlights and taillight</p> |