

General Information

Date & Time: 23, Jan, 2026 16:18

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	1,234
Registration No.	GBF1986	Chassis No.	PA1B18F37R42621162
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



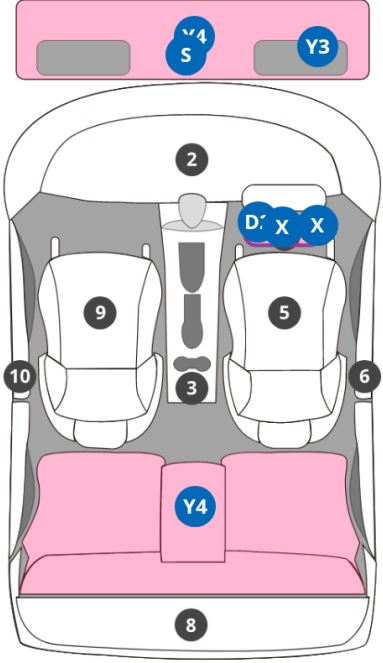
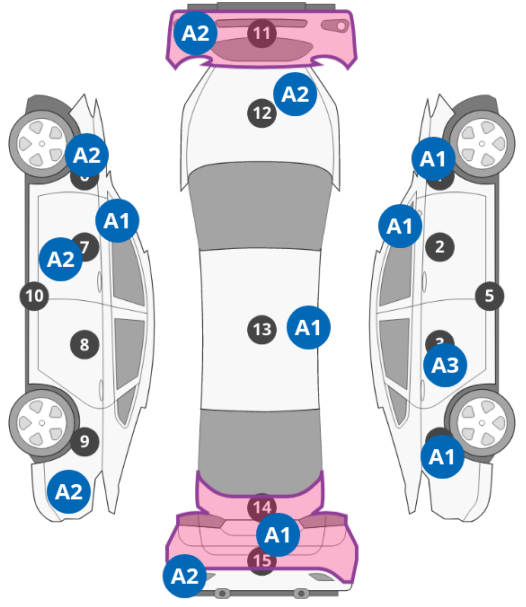
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	118	111	116
2	Boot Lid	268.0	159	508	137
3	Roof	102.0	107	99	97/106
4	Left Front Fender	103.7	110	103	98
5	Left Front Door	109.3	111	108	109
6	Center Panel Left				
7	Left Rear Door	107.6	114	108	101
8	Left Back Panel	104.9	111	104	100
9	Right Front Fender	144.0	145	138	149
10	Right Front Door	157.6	172	151	150
11	Center Panel Right				
12	Right Rear Door	118.6	113	110	133
13	Right Back Panel	152.0	150	146	160

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Large / Overall Interior - Smell - Yes / Sunvisor, Sunglass Holder - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Large	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes
Frame Evaluation : C	Functional Evaluation : E
Remarks Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Non moving vehicle. Flooded unit. Yellowstains and water marks at left headlight. Gap at trunk door. With warranty booklet, jack and spare tire. Incomplete tools and seat cover. 1 key. No LTO plate.