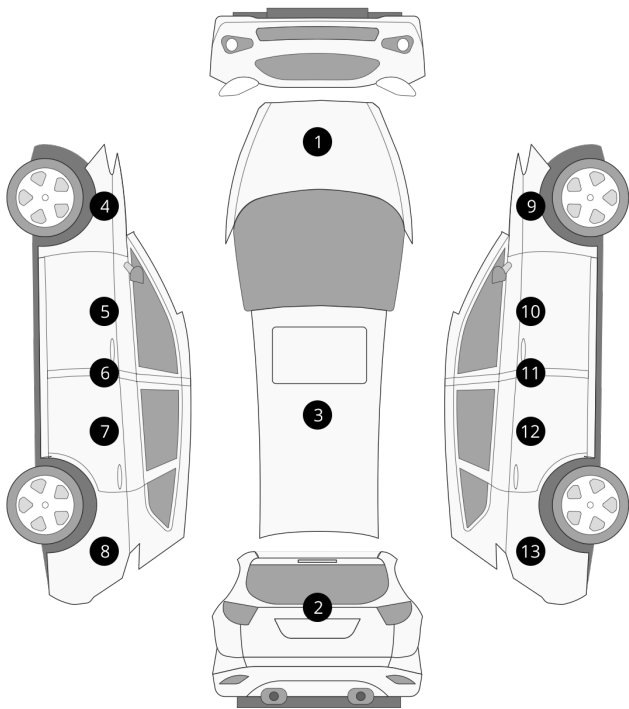


## General Information

**Date & Time: 14, Jan, 2026 15:55**

<b>Make</b>	Toyota	<b>Model</b>	Hiace
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	98,792
<b>Registration No.</b>	DAT1737	<b>Chassis No.</b>	JTFJT02P1L5024201
<b>CC</b>	3.0	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	Silver		

## Body / Panel Condition



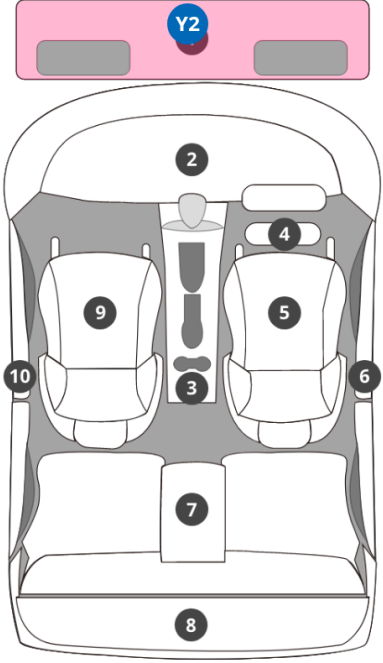
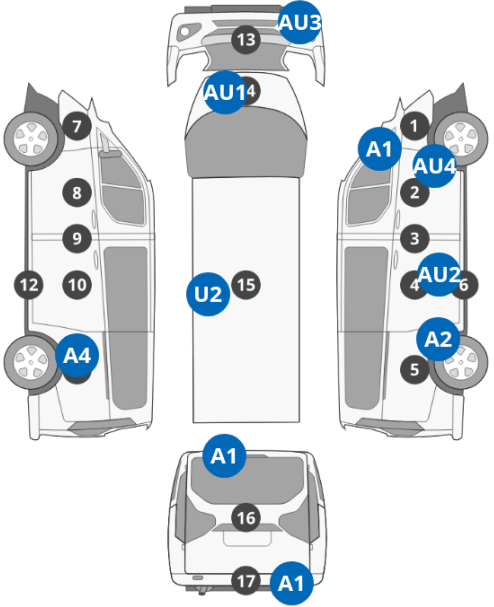
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>111.6</b>	109	112	114
2	Boot Lid	<b>105.0</b>	106	108	101
3	Roof	<b>119.2</b>	112	112	121/132
4	Left Front Fender	<b>125.6</b>	126	127	124
5	Left Front Door	<b>107.6</b>	108	111	104
6	Center Panel Left	<b>69.5</b>	61	75	72
7	Left Rear Door				
8	Left Back Panel	<b>105.0</b>	114	95	106
9	Right Front Fender	<b>131.3</b>	130	128	136
10	Right Front Door	<b>112.3</b>	120	107	110
11	Center Panel Right	<b>107.1</b>	93	103	126
12	Right Rear Door	<b>106.3</b>	102	111	106
13	Right Back Panel	<b>105.6</b>	107	107	103

**Overall Evaluation :**

B

**Disclaimer**

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Ceiling - Grime - Small	<b>Remarks</b> (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Minimal / Roof - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Minimal
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Brake Pedal - Function - Weak / Wiper - Function - Weak / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
With Lto plate, 1key, no warranty booklet, no spare tire, no jack and tools, scratches on headlight and taillight, break pedal issue, battery weak