


## General Information

Date & Time: 05, Jan, 2026 13:14

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2014	<b>Odo Meter Reading</b>	178,686
<b>Registration No.</b>	AAW6876	<b>Chassis No.</b>	AZ015805
<b>CC</b>	2.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	Silver		

## Body / Panel Condition

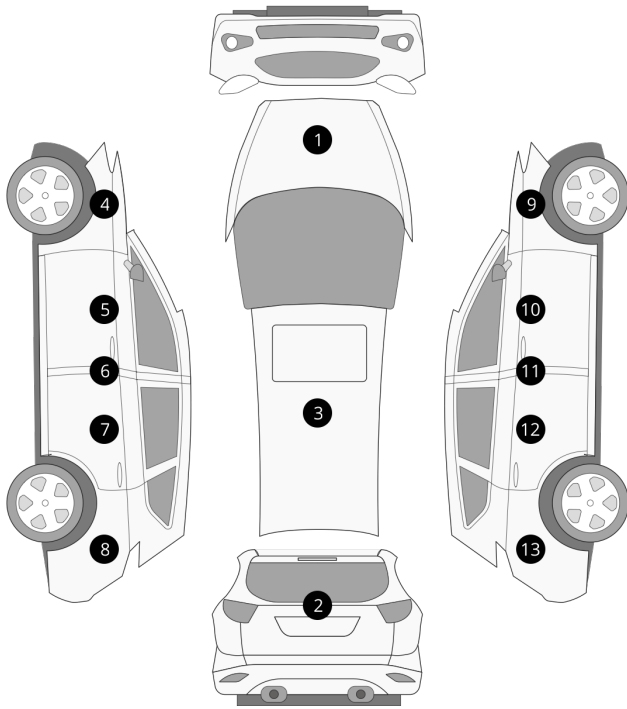

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.1	96	92	106
2	Boot Lid	95.5	94	94	99
3	Roof	98.1	103	97	96/97
4	Left Front Fender	100.3	100	102	99
5	Left Front Door	104.3	101	107	105
6	Center Panel Left				
7	Left Rear Door	104.0	102	103	107
8	Left Back Panel	99.8	104	100	96
9	Right Front Fender	120.0	102	131	127
10	Right Front Door	99.4	97	101	100
11	Center Panel Right				
12	Right Rear Door	105.3	94	107	115
13	Right Back Panel	169.0	170	158	179

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	<b>E</b>	<b>Exterior Evaluation :</b>	<b>E</b>
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (L) Front Seat - Grime - Large / (R) Front Seat - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Large / Glove Box - Loose, Deformed - Large / Rear Seat - Grime - Large / (R) Front Floor Mat - Worked - Large / Ceiling - Grime - Large / (L) Front Trim - Worked - Large</p>		<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Front Windshield - Damaged - Large / (L) Front Fender, Molding - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / Roof - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Crack, Gap - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Scratch &amp; Dent - Large / Bonnet, Headlight - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Mirror - Scratch - Small / (R) Mirror - Scratch - Small</p>	
<p><b>Frame Evaluation :</b></p>		<p><b>Functional Evaluation :</b></p>	
<b>B</b>		<b>B</b>	
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>		<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>	

<b>Inspector Notes</b>
tail light issue/ head light issue/ possible flooding/ no LTO plate/ no warranty booklet/ no jack and tools/ with spare tire/