

## General Information

Date & Time: 10, Jan, 2026 18:32

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	44,552
<b>Registration No.</b>	NHM3541	<b>Chassis No.</b>	PA1B18F37R4239674
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	White		

## Body / Panel Condition



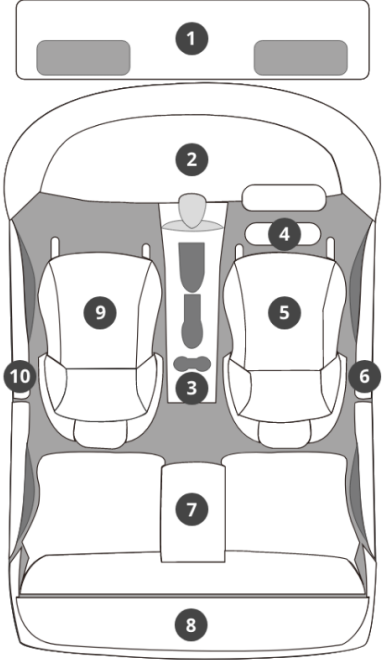
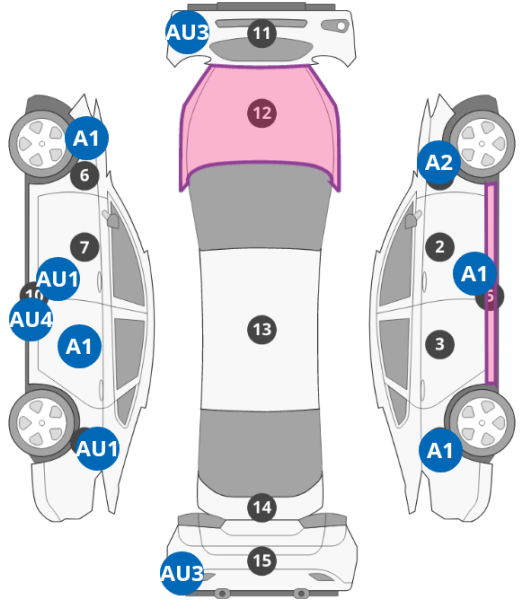
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>170.3</b>	131	161	219
2	Boot Lid	<b>118.3</b>	124	106	125
3	Roof	<b>99.9</b>	104	100	96/100
4	Left Front Fender	<b>670.6</b>	588	884	540
5	Left Front Door	<b>119.3</b>	156	102	100
6	Center Panel Left				
7	Left Rear Door	<b>103.0</b>	112	100	97
8	Left Back Panel	<b>108.0</b>	121	101	102
9	Right Front Fender	<b>134.3</b>	114	137	152
10	Right Front Door	<b>194.6</b>	206	168	210
11	Center Panel Right				
12	Right Rear Door	<b>223.3</b>	252	183	235
13	Right Back Panel	<b>213.6</b>	183	209	249

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<p><b>Remarks</b> Front Cross Member Support - Condition of Welding ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with spare and jack, 1key, no warranty booklet, no tools, scratches on headlight and taillight issue on room light</p>