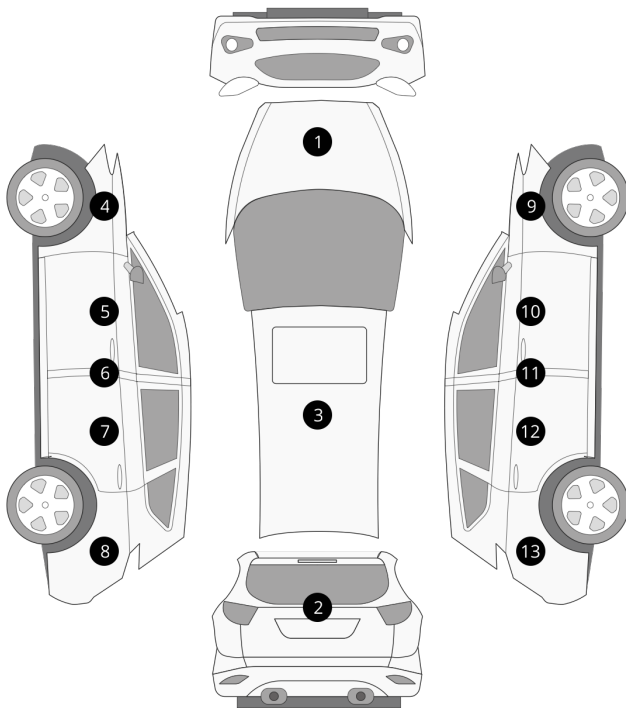


## General Information

Date & Time: 10, Jan, 2026 18:54

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	157,336
<b>Registration No.</b>	NFG5849	<b>Chassis No.</b>	PA1B18F32M4162835
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



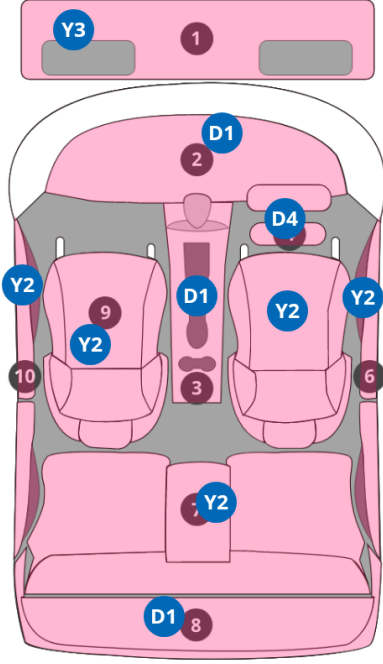
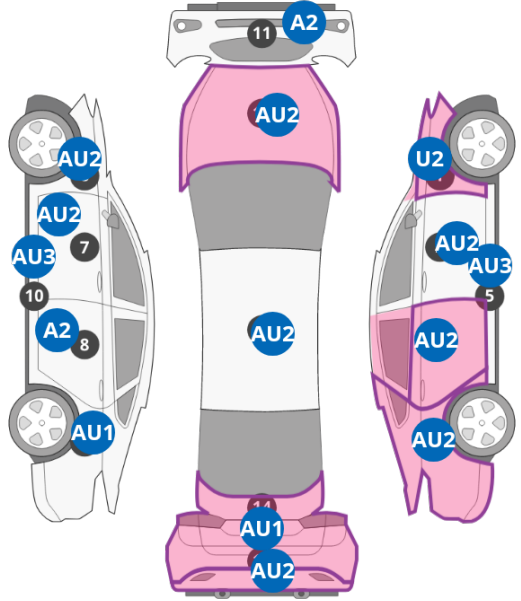
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.4	157	82	107
2	Boot Lid	389.0	150	856	161
3	Roof	93.3	83	113	85/93
4	Left Front Fender	84.0	76	94	83
5	Left Front Door	117.3	111	121	120
6	Center Panel Left				
7	Left Rear Door	119.0	121	114	122
8	Left Back Panel	207.3	284	154	184
9	Right Front Fender	500.0	172	662	666
10	Right Front Door	96.2	93	100	96
11	Center Panel Right				
12	Right Rear Door	125.6	140	115	122
13	Right Back Panel	114.6	110	115	119

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<p><b>Interior Evaluation :</b> <span style="float: right;"><b>C</b></span></p>	<p><b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span></p>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Console, Switchs, Vents - Worked - Minimal / Ceiling - Grime - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal / Dashboard - Worked - Minimal</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small</p>
<p><b>Frame Evaluation :</b> <span style="float: right;"><b>D</b></span></p>	<p><b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span></p>
<p><b>Remarks</b> Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

with LTO plate, with spare tire, with jack, no spare key, no tools, no manual and warranty booklet, no reverse camera, issue on transmission, scratches on taillight.