

General Information

Date & Time: 05, Jan, 2026 11:38

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	22,990
Registration No.	BAG8259	Chassis No.	PA1B18F3XR4281338
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



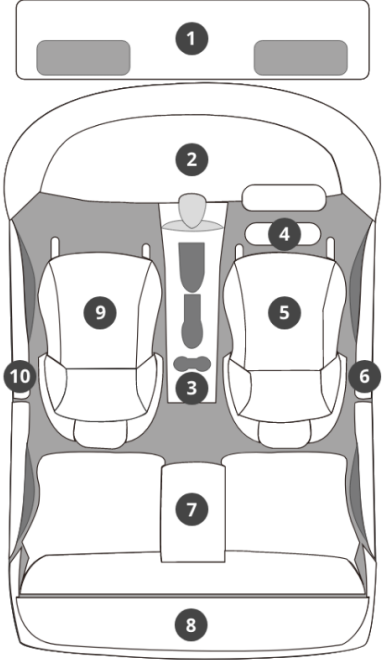
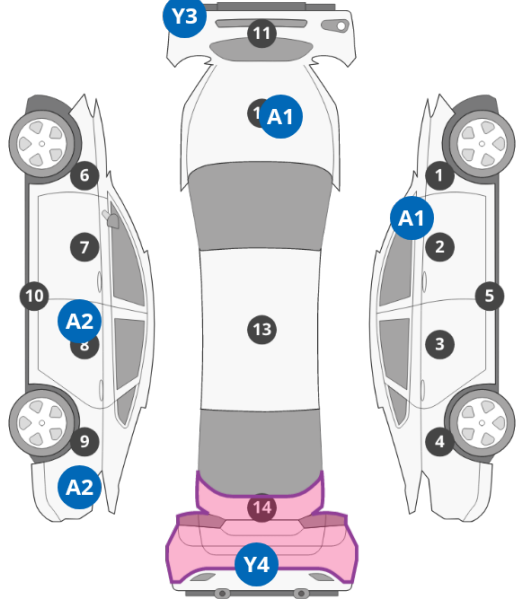
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.8	115	82	109
2	Boot Lid	457.0	145	1,075	151
3	Roof	97.9	97	103	90/102
4	Left Front Fender	91.7	89	90	96
5	Left Front Door	101.4	94	106	104
6	Center Panel Left				
7	Left Rear Door	98.3	97	96	102
8	Left Back Panel	100.0	104	105	91
9	Right Front Fender	143.0	137	150	142
10	Right Front Door	192.0	207	168	201
11	Center Panel Right				
12	Right Rear Door	201.0	205	195	203
13	Right Back Panel	433.6	412	469	420

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Defects not found</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch, Peeled - Minimal / Overall Exterior - Full Re-Paint in same color - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Repair mark - Difference in Color / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Spare Key - Issue - Unexist</p>	

Inspector Notes
With Lto plate, with jack and tools, 1key, no warranty booklet, no spare tire,scratches on headlight and taillight, traces of adhesive on door handle