

## General Information

Date & Time: 07, Jan, 2026 11:30

<b>Make</b>	Toyota	<b>Model</b>	Hilux Tamaraw
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	29,501
<b>Registration No.</b>	NKN9031	<b>Chassis No.</b>	PAHACACAXS6424314
<b>CC</b>	2.4	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Utility Passenger
<b>Colour</b>	White		

## Body / Panel Condition



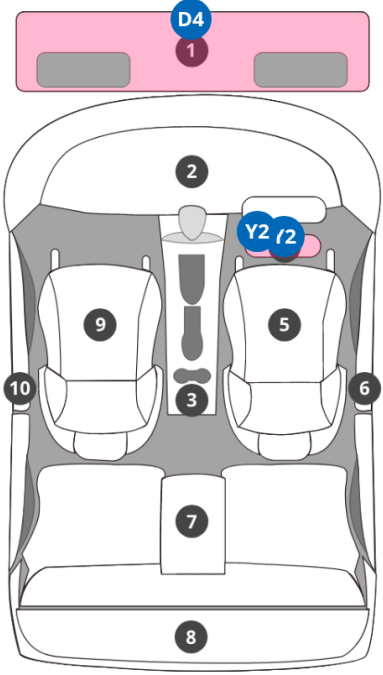
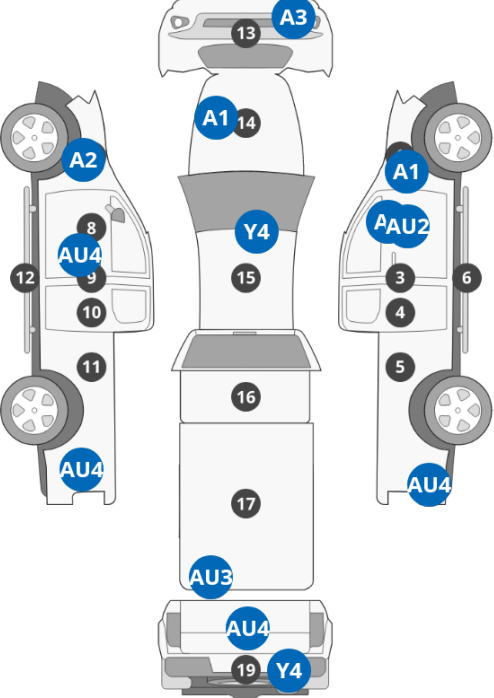
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>101.7</b>	104	107	94
2	Boot Lid	<b>55.4</b>	65	46	56
3	Roof	<b>103.6</b>	123	112	69/111
4	Left Front Fender	<b>98.6</b>	94	100	102
5	Left Front Door	<b>93.9</b>	92	95	95
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	<b>59.1</b>	48	66	63
9	Right Front Fender	<b>102.6</b>	105	101	102
10	Right Front Door	<b>96.4</b>	94	99	96
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	<b>60.8</b>	62	64	57

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Grime - Small / Ceiling - Loose, Deformed - Large / (L) Front Floor Mat - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Side Gate - Scratch &amp; Dent - Large / Rear Gate - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Front Fender, Molding - Scratch - Small / Front Windshield - Damaged - Large / Roof - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Side Gate - Scratch &amp; Dent - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with spare tire and jack, 1key, no tools, no warranty booklet, scratches on headlight and taillight, possible flooding,</p>