

General Information

Date & Time: 05, Jan, 2026 17:11

Make	Toyota	Model	Veloz
YOM	2023	Odo Meter Reading	62,803
Registration No.	CBI5716	Chassis No.	MHFAB1BY2P3061869
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



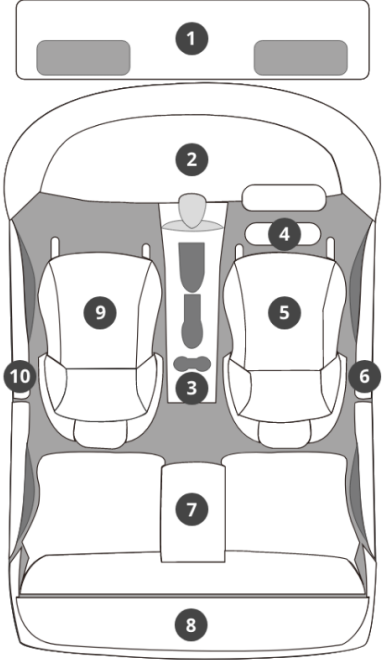
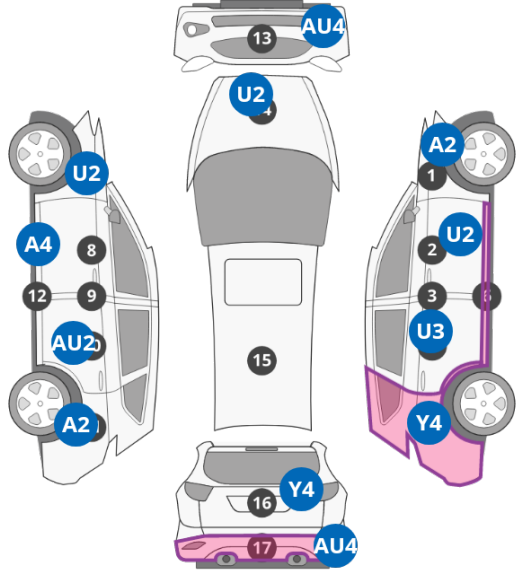
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	85.3	94	80	82
2	Boot Lid	164.6	100	205	189
3	Roof	95.7	100	94	93/96
4	Left Front Fender	93.5	92	92	97
5	Left Front Door	100.0	100	100	100
6	Center Panel Left				
7	Left Rear Door	103.7	117	101	93
8	Left Back Panel	108.4	95	115	115
9	Right Front Fender	97.1	92	100	99
10	Right Front Door	101.1	103	96	105
11	Center Panel Right				
12	Right Rear Door	99.3	96	95	108
13	Right Back Panel	910.0	253	1,225	1,252

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Defects not found</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Crack, Gap - Large / (R) Rear Fender, Molding - Crack, Gap - Large / (R) Step, In-panel, Side Spoiler - Partially Missing - Yes / (R) Rear Door, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Dent - Small / Bonnet, Headlight - Dent - Small / (R) Front Fender, Molding - Scratch - Small</p>	
Frame Evaluation :	C	Functional Evaluation :	B
<p>Remarks Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes</p>		<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
no jack and tools/ no warranty booklet/ with LTO plate and spare tire