

## General Information

Date & Time: 07, Jan, 2026 08:24

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	22,649
<b>Registration No.</b>	NHH3780	<b>Chassis No.</b>	PA1B18F32R4257242
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



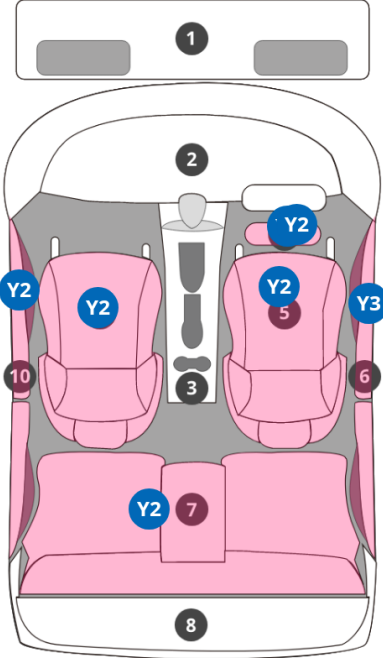
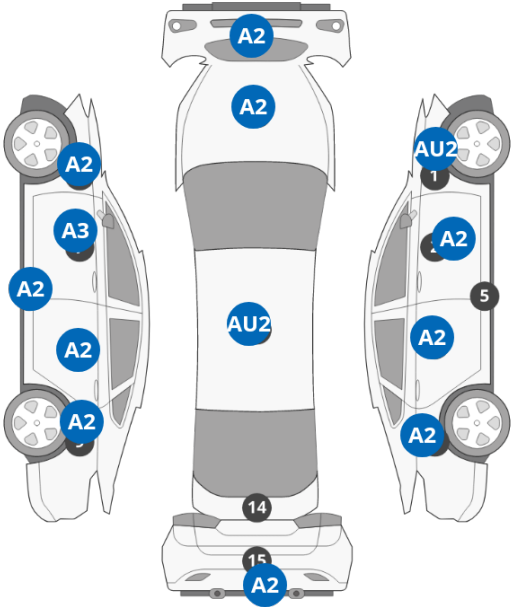
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	129	94	101
2	Boot Lid	100.8	99	98	106
3	Roof	104.2	103	109	102/103
4	Left Front Fender	107.3	100	112	110
5	Left Front Door	100.5	99	106	96
6	Center Panel Left				
7	Left Rear Door	102.1	103	96	108
8	Left Back Panel	105.3	109	103	104
9	Right Front Fender	125.0	112	154	109
10	Right Front Door	115.0	108	128	109
11	Center Panel Right				
12	Right Rear Door	109.3	114	105	109
13	Right Back Panel	124.6	103	101	170

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small</p>	<p><b>Remarks</b> (R) Rear Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire, with spare key, with incomplete tools and jack, with manual and warranty booklet, with reverse camera, scratches on taillight.</p>