

## General Information

Date & Time: 06, Jan, 2026 17:55

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	8,727
<b>Registration No.</b>	NHS9014	<b>Chassis No.</b>	PA1B18F36R4271743
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



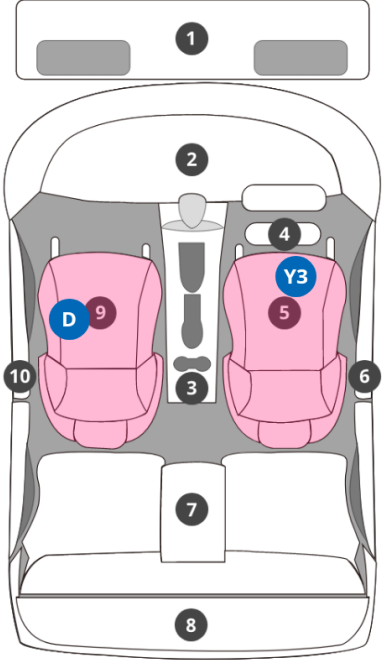
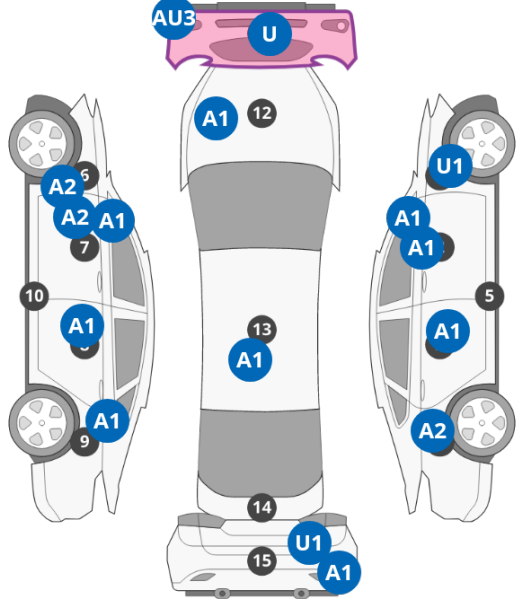
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	108	101	108
2	Boot Lid	102.0	104	101	101
3	Roof	91.0	96	94	84/90
4	Left Front Fender	98.4	101	99	95
5	Left Front Door	101.0	98	99	107
6	Center Panel Left				
7	Left Rear Door	103.3	113	103	94
8	Left Back Panel	102.2	105	102	100
9	Right Front Fender	208.3	151	275	199
10	Right Front Door	131.3	136	129	129
11	Center Panel Right				
12	Right Rear Door	96.3	93	96	100
13	Right Back Panel	97.7	96	97	100

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium	<b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Battery - Weak - Yes

<b>Inspector Notes</b>
with warranty booklet, jack, tools and spare tire, with LTO plate, scratches on tail light