

General Information

Date & Time: 15, Jan, 2026 15:20

Make	Suzuki	Model	Dzire
YOM	2024	Odo Meter Reading	66,134
Registration No.	GBE2041	Chassis No.	MBHZF63S6RG506596
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



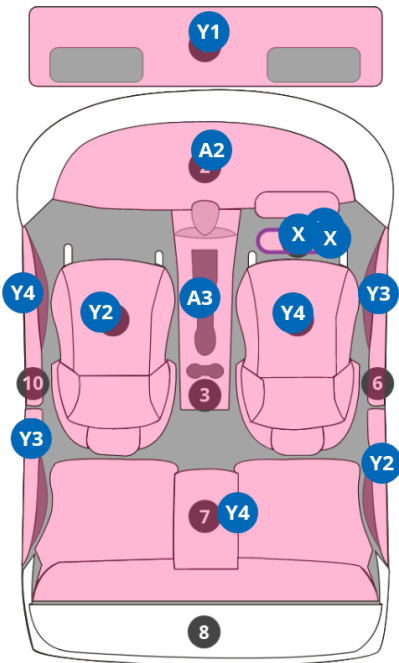
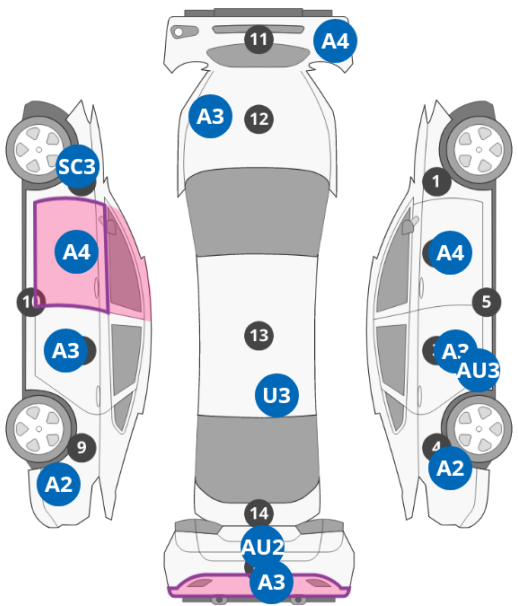
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.3	100	101	97
2	Boot Lid	76.2	80	76	73
3	Roof	100.9	93	93	104/114
4	Left Front Fender	145.6	127	134	176
5	Left Front Door	231.6	234	225	236
6	Center Panel Left				
7	Left Rear Door	159.0	233	130	114
8	Left Back Panel	88.9	100	91	76
9	Right Front Fender	96.0	102	98	88
10	Right Front Door	90.5	81	93	98
11	Center Panel Right				
12	Right Rear Door	84.0	81	85	86
13	Right Back Panel	92.2	83	96	98

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Large / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Seat - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Minimal</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Rust, Corrosion - Medium / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No jack and tools/No reverse camera/No warranty booklet/No seat cover /interior dirty/front and rear floor mat missing/</p>