

## General Information

Date & Time: 14, Jan, 2026 12:25

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2020	<b>Odo Meter Reading</b>	41,359
<b>Registration No.</b>	CAU7440	<b>Chassis No.</b>	PAEA13RJLLA016851
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



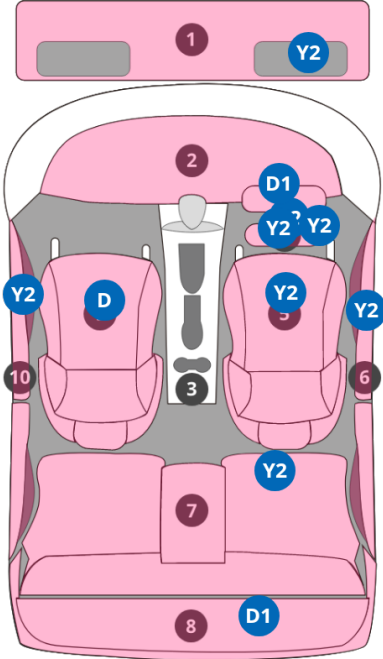
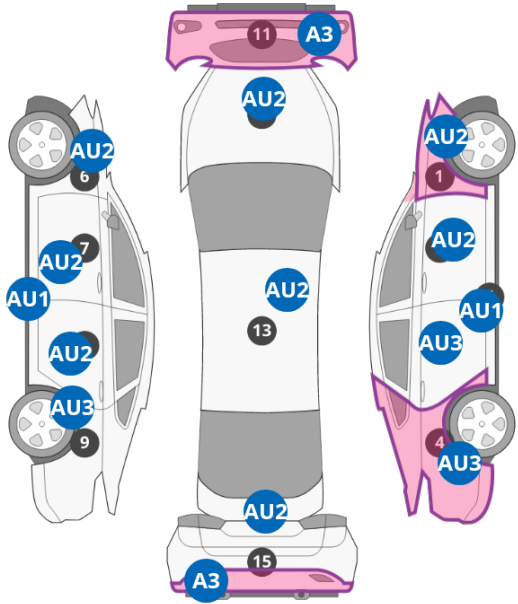
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	179.0	193	191	153
2	Boot Lid	205.6	181	273	163
3	Roof	222.5	246	196	236/212
4	Left Front Fender	214.6	216	212	216
5	Left Front Door	167.3	169	166	167
6	Center Panel Left				
7	Left Rear Door	182.0	202	167	177
8	Left Back Panel	204.6	211	238	165
9	Right Front Fender	466.6	725	316	359
10	Right Front Door	273.3	288	200	332
11	Center Panel Right				
12	Right Rear Door	347.6	358	384	301
13	Right Back Panel	1,124.3	1,070	1,076	1,227

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<p><b>Interior Evaluation :</b> <span style="float: right;"><b>C</b></span></p>	<p><b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span></p>
<div style="text-align: center;">  </div> <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	<div style="text-align: center;">  </div> <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / Glove Box - Worked - Minimal / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Bonnet, Headlight - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Minimal</p>
<p><b>Frame Evaluation :</b> <span style="float: right;"><b>D</b></span></p>	<p><b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span></p>
<p><b>Remarks</b> Rear Side Member &amp; Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Rear Side Member &amp; Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Door Lock - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire, no spare key, battery issue, aircon issue, headunit issue, door lock issue, scratches on taillight and headlight, no tools and jack, no reverse camera, no warranty and manual booklet.</p>