

General Information

Date & Time: 07, Jan, 2026 16:03

Make	Toyota	Model	Vios
YOM	2017	Odo Meter Reading	53,215
Registration No.	NCP7367	Chassis No.	PA1B19F33H4043218
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



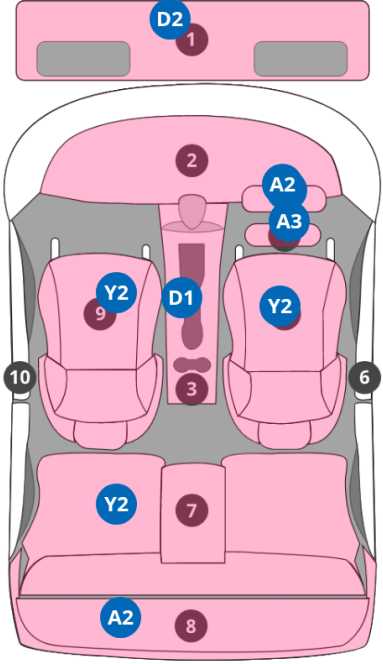
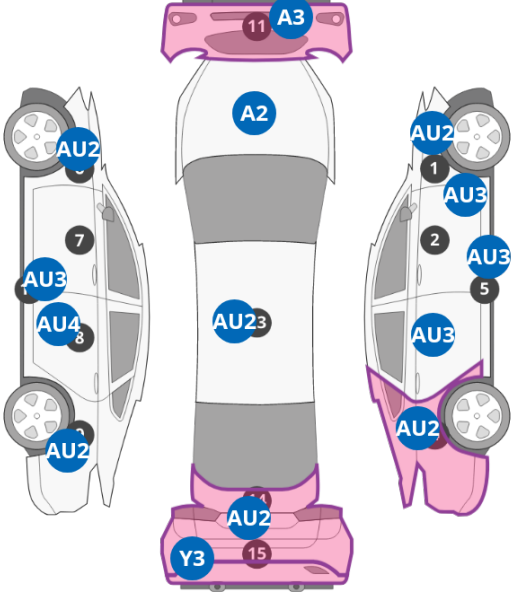
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	159.3	167	138	173
2	Boot Lid	190.6	163	214	195
3	Roof	414.7	171	1,170	154/164
4	Left Front Fender	192.6	181	148	249
5	Left Front Door	447.0	775	261	305
6	Center Panel Left				
7	Left Rear Door	158.6	158	153	165
8	Left Back Panel	263.3	274	222	294
9	Right Front Fender	185.0	175	185	195
10	Right Front Door	158.6	151	159	166
11	Center Panel Right				
12	Right Rear Door	262.0	296	251	239
13	Right Back Panel	597.6	756	504	533

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Worked - Minimal / Glove Box - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Cut, Crack - Medium / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Console, Switches, Vents - Worked - Minimal / Overall Interior - Worn as per age - Yes / Ceiling - Crinkle - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Scratch - Small / Overall Exterior - Full Re-Paint in same color - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes</p>
Frame Evaluation : D	Functional Evaluation : D
<p>Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Center Pillar - Condition of Welding ? - Yes</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with tools & jack, with spare key, no warranty and manual booklet, no reverse camera, issue on taillight, issue on window right side, no spare tire, issue on glove box, issue on aircon.</p>