

General Information

Date & Time: 16, Jan, 2026 08:49

Make	Toyota	Model	Hiace
YOM	2022	Odo Meter Reading	190,396
Registration No.	GAW3925	Chassis No.	JTFNAFAP4M8023524
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Black		

Body / Panel Condition



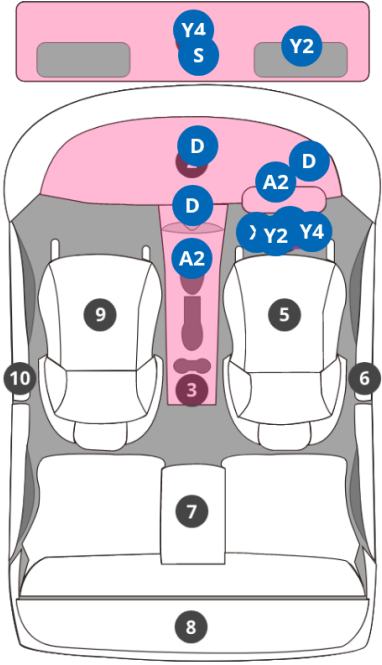
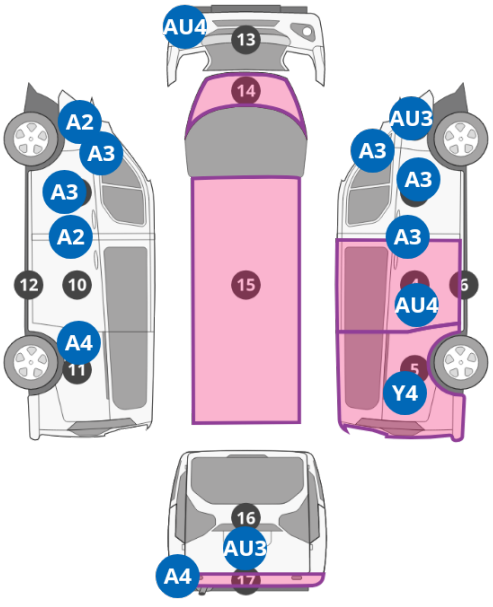
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	126	116	124
2	Boot Lid	135.0	138	139	128
3	Roof	139.2	115	128	134/180
4	Left Front Fender	138.6	141	135	140
5	Left Front Door	132.6	141	125	132
6	Center Panel Left	150.0	128	158	164
7	Left Rear Door				
8	Left Back Panel	143.6	143	131	157
9	Right Front Fender	145.3	137	143	156
10	Right Front Door	132.0	127	127	142
11	Center Panel Right	145.3	140	151	145
12	Right Rear Door	215.3	246	191	209
13	Right Back Panel	244.3	146	206	381

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / Carpet - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Mat Other - Grime - Large / Ceiling - Grime - Large / (R) Front Floor Mat - Grime - Small / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Small / Knobs - Worn, Peel, Crack - Small	Remarks (R) Step - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / (L) Rear Fender, Molding - Scratch - Large / (L) Center Panel - Scratch - Small / (L) Mirror - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Crack, Gap - Large / (R) Rear Door, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Center Panel - Scratch - Medium / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
Possible flooding. Battery for replacement. Front wiper issue. Without warranty booklet, jack and tools. With spare tire and seat cover. 1 key. No LTO plate.