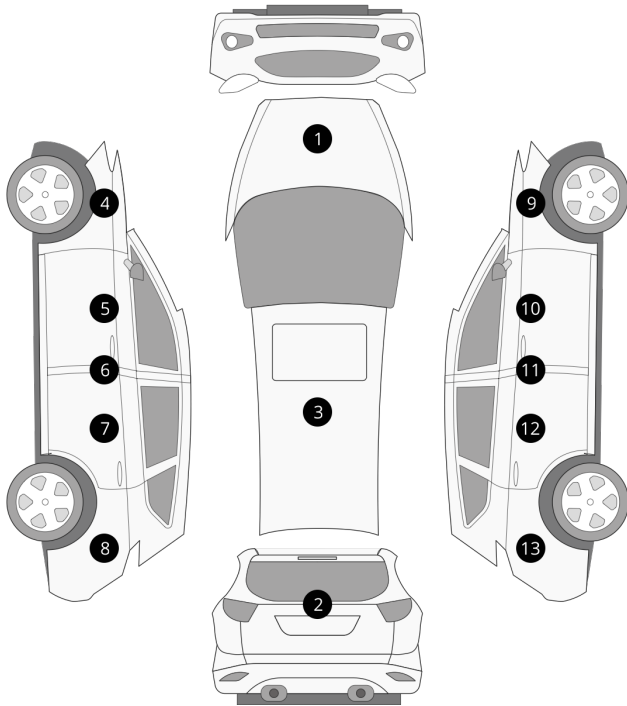


General Information

Date & Time: 09, Jan, 2026 15:52

Make	Hyundai	Model	Accent
YOM	2019	Odo Meter Reading	54,856
Registration No.	NEH1999-SELLER'S YARD	Chassis No.	PAHC741BBKH00973
CC	1.4	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



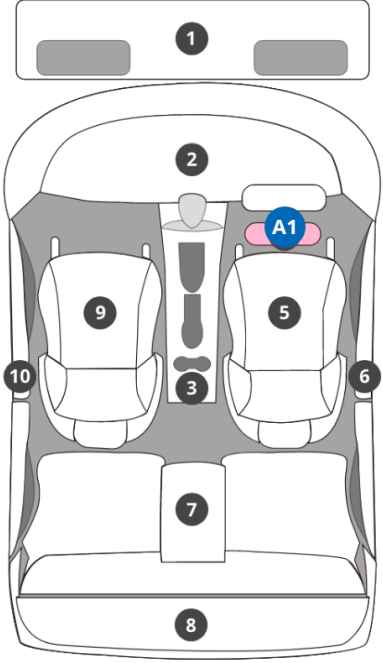
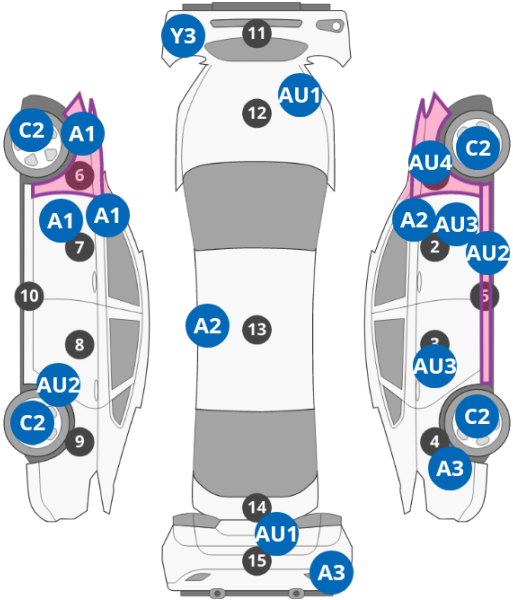
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	109	115	112
2	Boot Lid	123.3	120	132	118
3	Roof	111.4	109	114	100/123
4	Left Front Fender	230.6	259	240	193
5	Left Front Door	107.6	107	104	112
6	Center Panel Left				
7	Left Rear Door	117.3	126	117	109
8	Left Back Panel	108.0	123	95	106
9	Right Front Fender	180.6	149	178	215
10	Right Front Door	123.6	126	125	120
11	Center Panel Right				
12	Right Rear Door	125.3	117	126	133
13	Right Back Panel	311.0	609	166	158

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is". NEH1999-SELLER'S YARD. This report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Roof - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools,scratches on headlights and taillights</p>