

## General Information

Date & Time: 19, Jan, 2026 10:29

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	38,029
<b>Registration No.</b>	GAS5644	<b>Chassis No.</b>	PA1B18F38N4189779
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



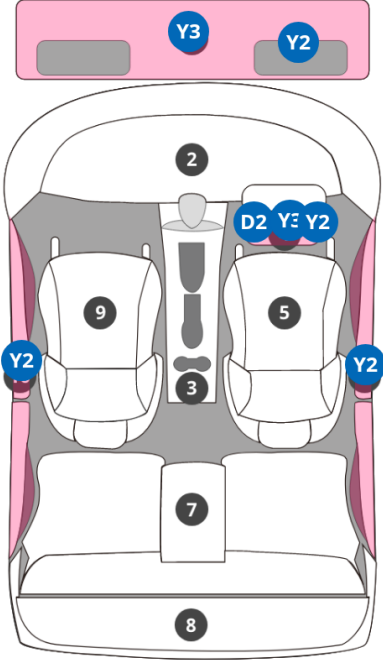
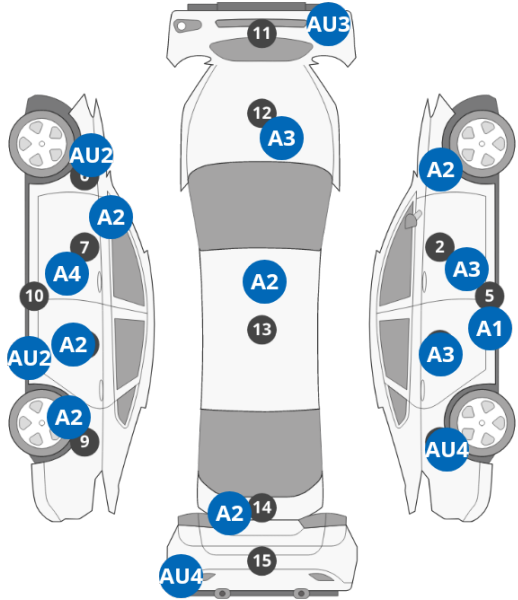
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	109	114	126
2	Boot Lid	103.0	103	101	105
3	Roof	98.4	103	98	95/97
4	Left Front Fender	103.0	103	103	103
5	Left Front Door	106.6	106	109	105
6	Center Panel Left				
7	Left Rear Door	113.6	117	118	106
8	Left Back Panel	106.3	113	104	102
9	Right Front Fender	99.2	97	97	104
10	Right Front Door	103.5	104	98	109
11	Center Panel Right				
12	Right Rear Door	100.8	94	98	110
13	Right Back Panel	103.7	105	98	108

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Sunvisor, Sunglass Holder - Grime - Small / Mat Other - Grime - Medium / (R) Front Trim - Grime - Small / Ceiling - Grime - Medium / (R) Front Floor Mat - Grime - Small</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet, tools, and jack. With spare tire and seat cover. 2 keys. With LTO plate.</p>