

## General Information

Date & Time: 12, Jan, 2026 11:31

<b>Make</b>	Mitsubishi	<b>Model</b>	Xpander
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	61,433
<b>Registration No.</b>	DAJ5441	<b>Chassis No.</b>	MK2XRVC1WKN015059
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Wagon
<b>Colour</b>	Silver		

## Body / Panel Condition



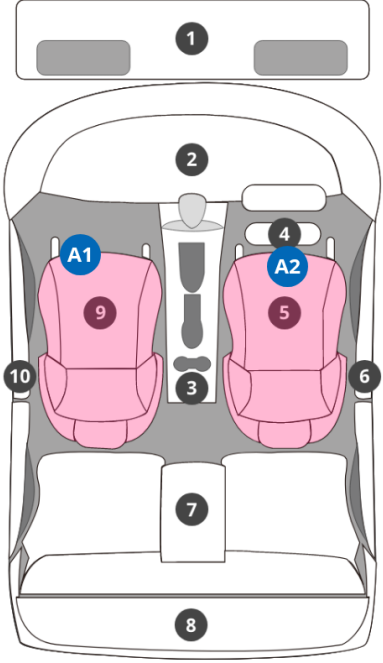
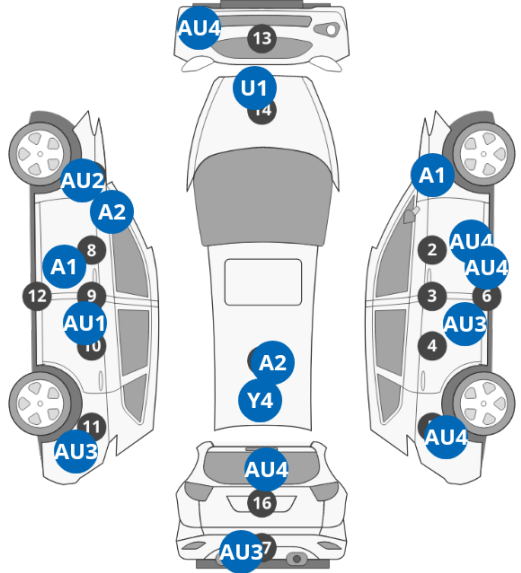
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	105	104	105
2	Boot Lid	94.3	87	90	106
3	Roof	103.9	111	99	106/100
4	Left Front Fender	89.7	91	91	88
5	Left Front Door	97.1	95	96	100
6	Center Panel Left				
7	Left Rear Door	94.3	95	95	93
8	Left Back Panel	103.6	101	106	104
9	Right Front Fender	97.5	95	102	96
10	Right Front Door	100.8	102	102	99
11	Center Panel Right				
12	Right Rear Door	98.2	94	100	101
13	Right Back Panel	110.0	120	105	105

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Cut, Crack - Small / (L) Front Seat - Cut, Crack - Minimal</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Rear Windshield - Damaged - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Dent - Minimal / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Air Conditioner - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools, aircon issue, cracked rear windshield