

General Information

Date & Time: 14, Jan, 2026 16:00

Make	Hyundai	Model	H100
YOM	2020	Odo Meter Reading	108,189
Registration No.	NDM9326	Chassis No.	KMFZBX7KAKU672562
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Shuttle
Colour	White		

Body / Panel Condition



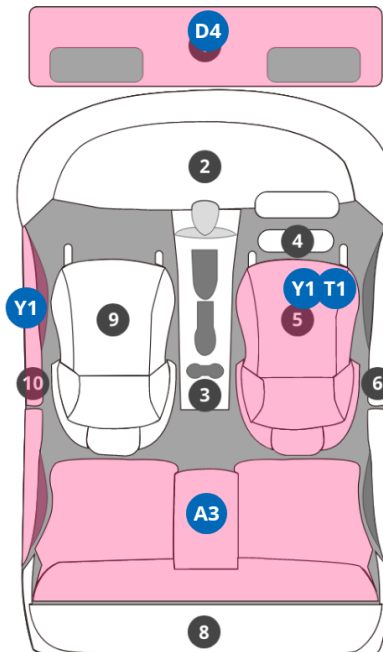
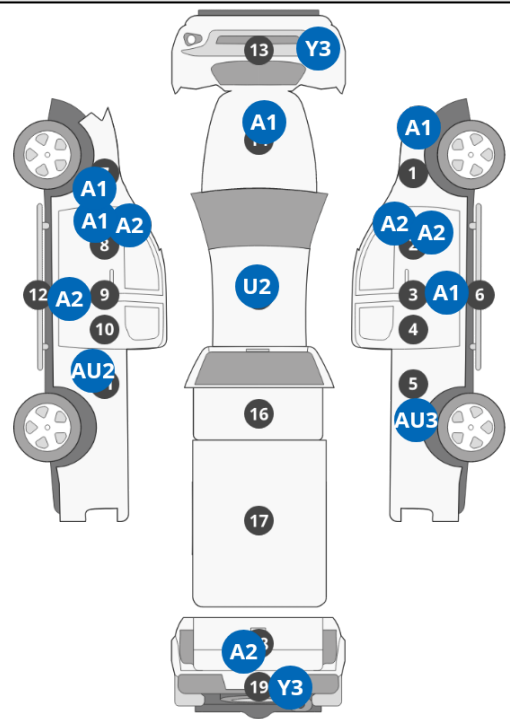
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	867.0	231	1,273	1,097
2	Boot Lid	195.6	197	183	207
3	Roof	150.5	151	125	155/171
4	Left Front Fender	321.6	219	266	480
5	Left Front Door	509.6	1,195	176	158
6	Center Panel Left	141.6	132	139	154
7	Left Rear Door				
8	Left Back Panel	188.6	168	166	232
9	Right Front Fender	412.6	209	183	846
10	Right Front Door	129.3	120	114	154
11	Center Panel Right	149.6	125	163	161
12	Right Rear Door				
13	Right Back Panel	214.0	197	218	227

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Cigarette Burns - Burnt Minimal / (L) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Cut, Crack - Medium / Ceiling - Loose, Deformed - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Rear Gate - Scratch - Small / (L) Side Gate - Scratch & Dent - Small / (L) Center Panel - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire, 2keys, no warranty booklet, no jack and tools, rear door lock issue,aircon issue,door handle issue</p>