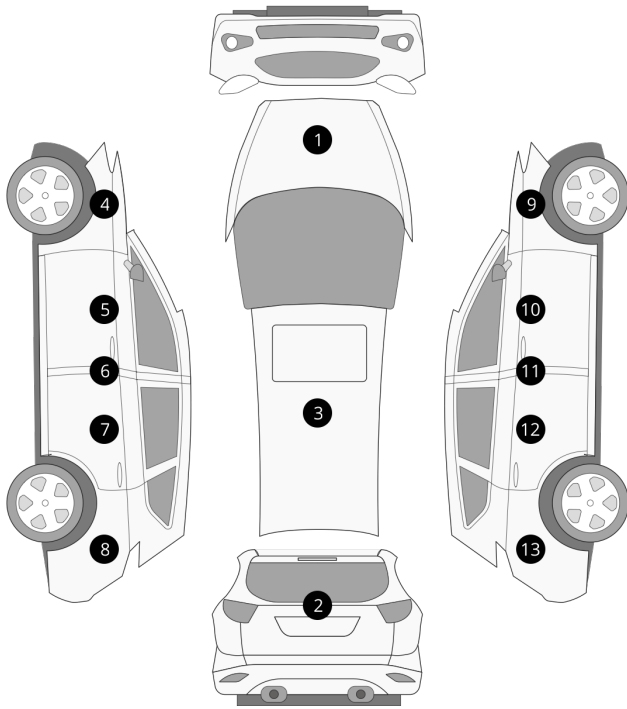


## General Information

Date & Time: 10, Jan, 2026 14:19

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	26,767
<b>Registration No.</b>	CAZ7701	<b>Chassis No.</b>	MHKAA1BC2PJ003247
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Silver		

## Body / Panel Condition



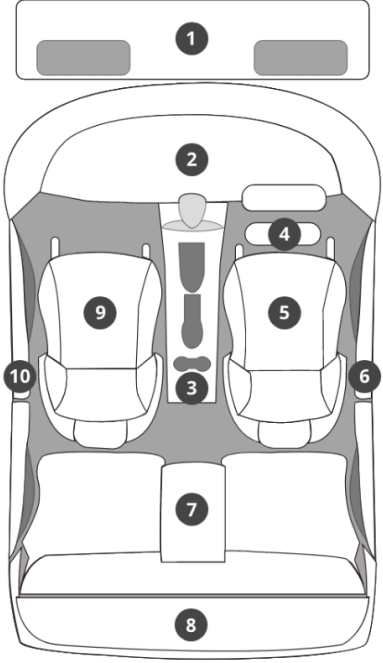
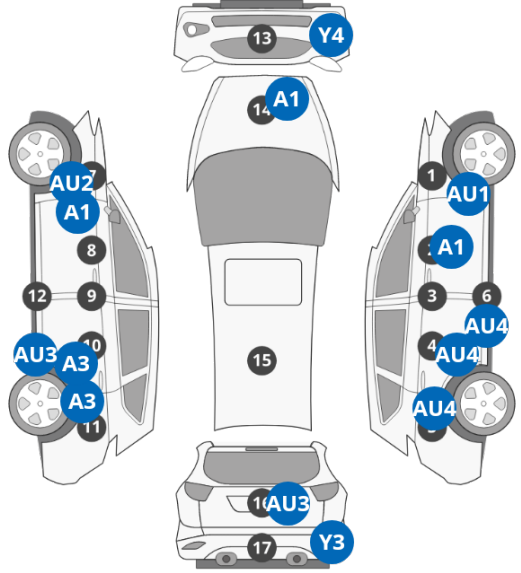
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	111	121	100
2	Boot Lid	95.4	94	98	94
3	Roof	84.1	83	84	88/82
4	Left Front Fender	97.6	92	101	100
5	Left Front Door	104.2	98	104	111
6	Center Panel Left				
7	Left Rear Door	106.3	109	100	110
8	Left Back Panel	97.9	107	92	95
9	Right Front Fender	101.5	107	98	99
10	Right Front Door	104.1	117	98	98
11	Center Panel Right				
12	Right Rear Door	107.2	112	96	114
13	Right Back Panel	98.2	105	94	96

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Defects not found	<b>Remarks</b> (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Reverse Camera - N/A - Yes

<b>Inspector Notes</b>
No Lto plate, 2keys, with warranty booklet, with spare tire, no jack and tools, no bonnet under cover,scratches on headlight and taillight