

## General Information

Date & Time: 10, Jan, 2026 14:20

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	80,182
<b>Registration No.</b>	NIO3318	<b>Chassis No.</b>	PA1B18F38P4214750
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



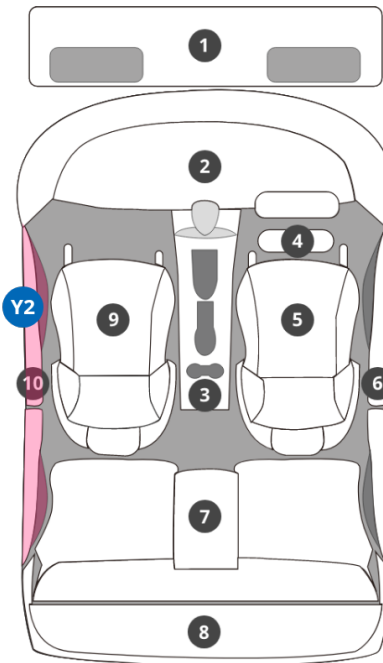
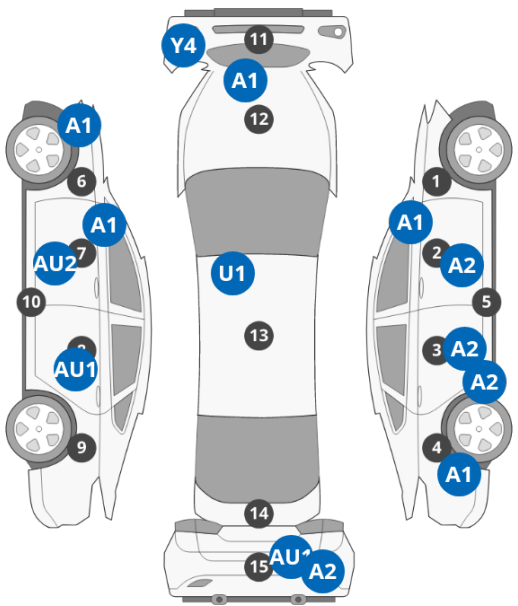
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	157.0	150	164	157
2	Boot Lid	111.3	110	105	119
3	Roof	96.7	102	102	89/94
4	Left Front Fender	258.6	344	250	182
5	Left Front Door	158.0	213	121	140
6	Center Panel Left				
7	Left Rear Door	128.0	135	125	124
8	Left Back Panel	109.0	116	106	105
9	Right Front Fender	153.0	155	146	158
10	Right Front Door	141.0	131	98	194
11	Center Panel Right				
12	Right Rear Door	131.6	124	127	144
13	Right Back Panel	109.6	104	110	115

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-size: 24px; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-size: 24px; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (L) Front Trim - Grime - Small	<b>Remarks</b> (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Roof - Dent - Minimal / Bonnet, Headlight - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="color: red; font-size: 24px; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="color: red; font-size: 24px; font-weight: bold;">A</span>
<b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	<b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlight and taillight