

General Information

Date & Time: 10, Jan, 2026 14:18

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	56,555
Registration No.	NGL9233	Chassis No.	PA1B18F3XM4135673
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



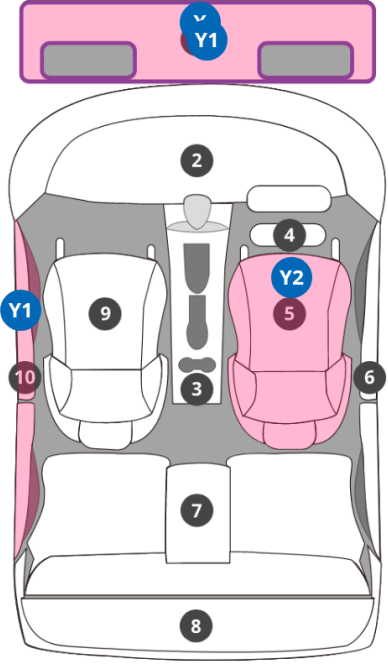
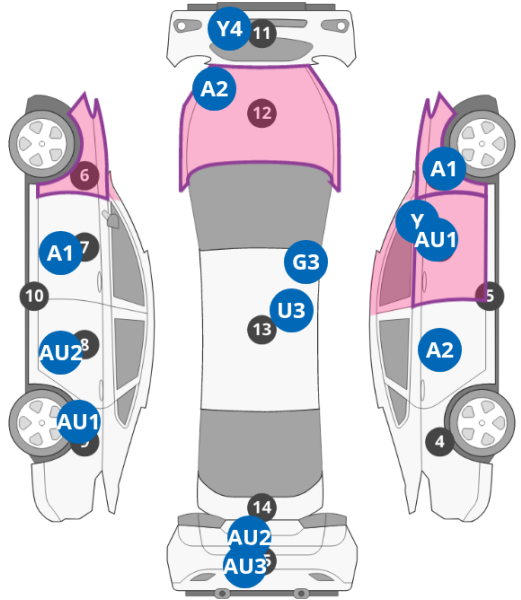
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	155.0	132	156	177
2	Boot Lid	111.6	118	100	117
3	Roof	97.6	107	93	89/102
4	Left Front Fender	139.6	150	145	124
5	Left Front Door	103.0	100	105	104
6	Center Panel Left				
7	Left Rear Door	97.7	97	98	98
8	Left Back Panel	112.6	117	108	113
9	Right Front Fender	623.0	1,181	522	166
10	Right Front Door	343.0	142	168	719
11	Center Panel Right				
12	Right Rear Door	102.1	110	94	102
13	Right Back Panel	110.6	107	105	120

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Sunvisor, Sunglass Holder - Missing - Yes / Ceiling - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Crack - Damaged / (R) Front Door, Molding - Repair mark - Difference in Color / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Difference in Color / Bonnet, Headlight - Repair mark - Difference in Color / Bonnet, Headlight - Scratch - Small / Front Windshield - Scratch, Stone chip - Medium / Roof - Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No Lto plate, 1key, with spare tire, no jack and tools, scratches on headlight and taillight, no bonet under cover,issue on glove box</p>