

General Information

Date & Time: 10, Jan, 2026 11:05

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	121,037
Registration No.	NGA1790	Chassis No.	PA1B18F30L4117200
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



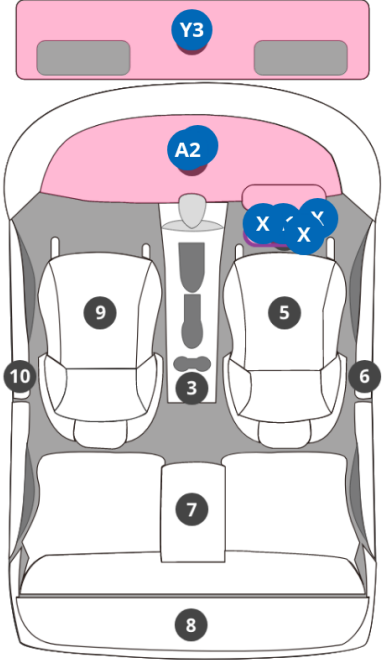
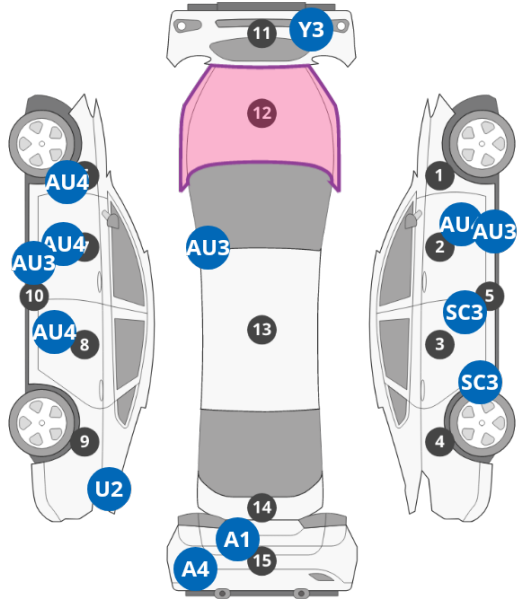
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	253.3	233	277	250
2	Boot Lid	112.3	115	102	120
3	Roof	111.1	125	131	97/91
4	Left Front Fender	805.0	768	1,010	637
5	Left Front Door	174.6	178	175	171
6	Center Panel Left				
7	Left Rear Door	119.6	132	128	99
8	Left Back Panel	156.6	162	168	140
9	Right Front Fender	168.0	134	149	221
10	Right Front Door	98.0	97	102	96
11	Center Panel Right				
12	Right Rear Door	102.0	106	98	102
13	Right Back Panel	103.6	93	96	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Sunvisor, Sunglass Holder - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Carpet - Worn, Scratch, Cut, Crack - Minimal / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Steering Wheel - Worn, Peel, Crack - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Rust, Corrosion - Medium / (R) Rear Fender, Molding - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Repair mark - Yes / Roof - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate,with warranty booklet, with spare tire and jack, 1key, no tools, possible flooding,issue on left door,scratches on headlights and taillights</p>