

## General Information

Date & Time: 10, Jan, 2026 19:02

<b>Make</b>	Honda	<b>Model</b>	Brio
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	33,297
<b>Registration No.</b>	NEQ6450	<b>Chassis No.</b>	MHRDD1860MJ0772
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Red		

## Body / Panel Condition



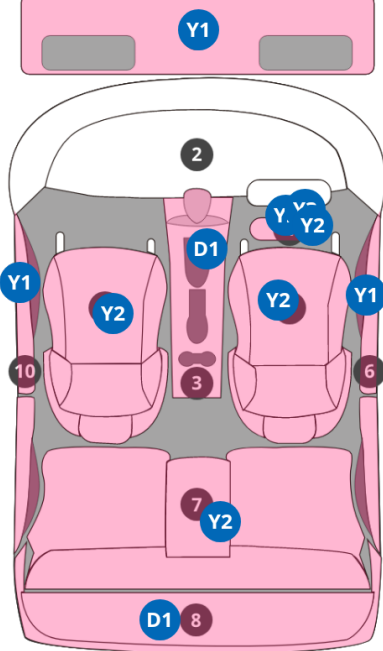
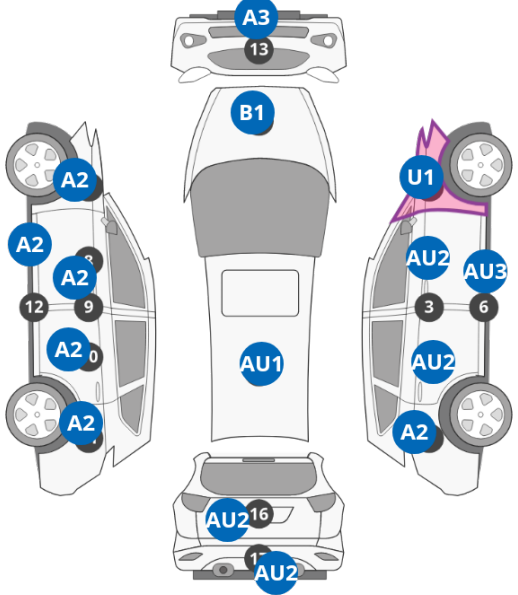
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.0	110	86	77
2	Boot Lid	89.3	95	81	93
3	Roof	105.8	99	106	112/106
4	Left Front Fender	146.6	166	143	131
5	Left Front Door	100.3	96	94	111
6	Center Panel Left				
7	Left Rear Door	105.6	117	110	90
8	Left Back Panel	102.7	94	114	100
9	Right Front Fender	145.6	129	159	149
10	Right Front Door	160.0	185	152	143
11	Center Panel Right				
12	Right Rear Door	189.0	154	191	222
13	Right Back Panel	139.6	125	140	154

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Medium / Mat Other - Grime - Small / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal / Console, Switches, Vents - Worked - Minimal / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Modified - Minimal / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Dent - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with warranty and manual booklet, with jack, with no tools, no reverse camera, no spare key, scratches on taillight</p>