

## General Information

Date & Time: 15, Jan, 2026 15:47

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	18,076
<b>Registration No.</b>	DBN5084	<b>Chassis No.</b>	PA1B18F31P4228960
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



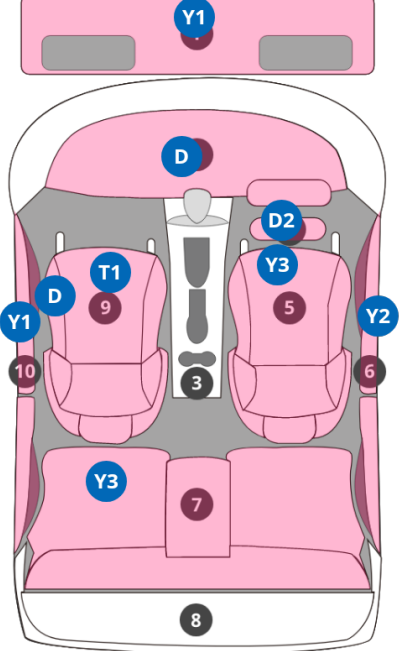
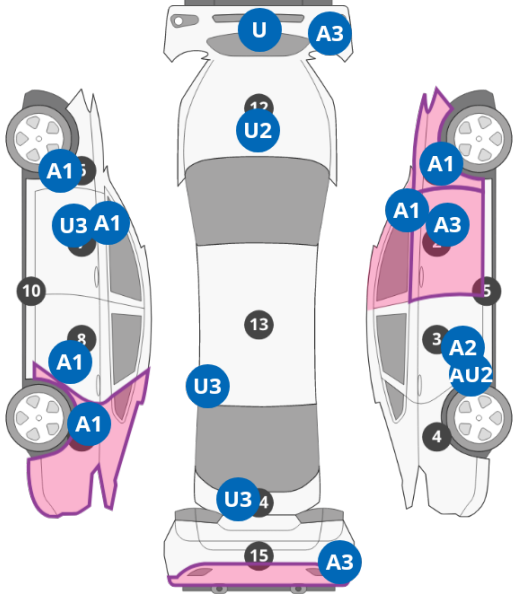
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	103	102	114
2	Boot Lid	118.0	113	131	110
3	Roof	98.0	102	102	88/100
4	Left Front Fender	102.3	102	97	108
5	Left Front Door	97.9	100	93	101
6	Center Panel Left				
7	Left Rear Door	102.9	98	112	99
8	Left Back Panel	143.3	130	140	160
9	Right Front Fender	99.7	101	101	97
10	Right Front Door	95.6	102	92	93
11	Center Panel Right				
12	Right Rear Door	102.0	97	102	107
13	Right Back Panel	104.3	102	105	106

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Cigarette Burns - Burnt Minimal / Ceiling - Grime - Minimal / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> Member (Bolted) - Dent - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Wheel, Cover - Cap Missing - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Small / Roof - Dent - Medium / (L) Rear Fender, Molding - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet and jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light</p>