

## General Information

Date & Time: 13, Jan, 2026 15:59

<b>Make</b>	MG	<b>Model</b>	ZS
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	32,621
<b>Registration No.</b>	NIH5376	<b>Chassis No.</b>	LSJW7496NZ170534
<b>CC</b>	1.3	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Black		

## Body / Panel Condition



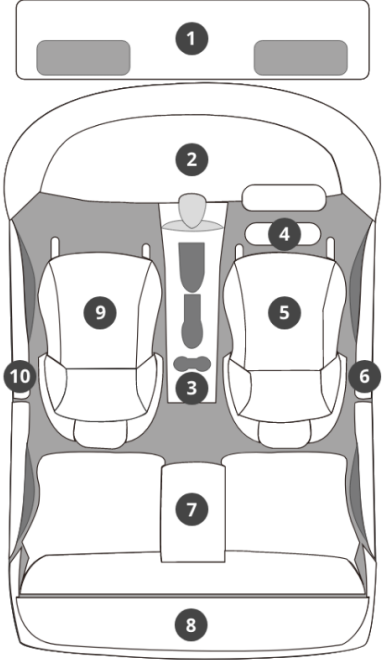
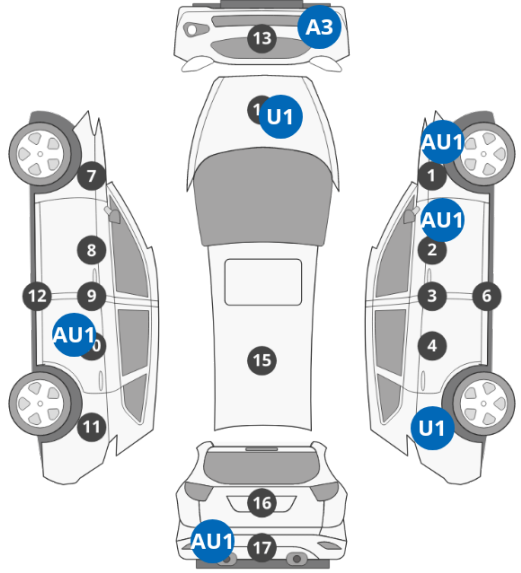
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	159.6	164	163	152
2	Boot Lid	131.0	127	138	128
3	Roof	109.2	108	112	111/106
4	Left Front Fender	131.6	136	121	138
5	Left Front Door	128.6	135	126	125
6	Center Panel Left				
7	Left Rear Door	132.3	135	137	125
8	Left Back Panel	129.6	118	131	140
9	Right Front Fender	133.6	136	134	131
10	Right Front Door	129.6	132	126	131
11	Center Panel Right				
12	Right Rear Door	127.6	123	131	129
13	Right Back Panel	141.0	137	148	138

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	<b>A</b>	<b>Exterior Evaluation :</b>	<b>B</b>
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch &amp; Dent - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Minimal</p>	
<b>Frame Evaluation :</b>		<b>Functional Evaluation :</b>	
<b>A</b>		<b>C</b>	
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Warning Lamps - Issue - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>	

<b>Inspector Notes</b>
<p>With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools, scratches on headlights and taillights,</p>