

## General Information

Date & Time: 14, Jan, 2026 11:24

<b>Make</b>	Ford	<b>Model</b>	Everest
<b>YOM</b>	2020	<b>Odo Meter Reading</b>	21,367
<b>Registration No.</b>	ZAB4713	<b>Chassis No.</b>	MNCAXXMAWALB91737
<b>CC</b>	2.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	White		

## Body / Panel Condition



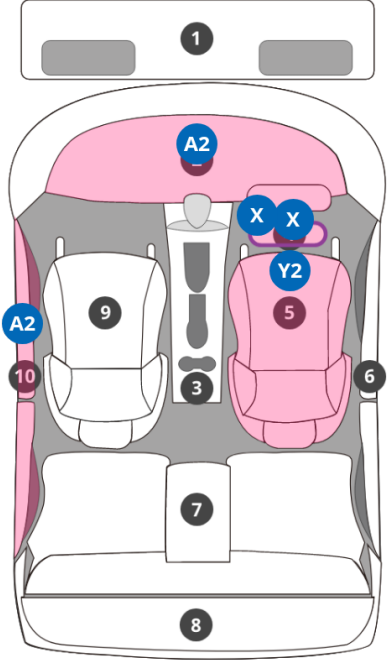
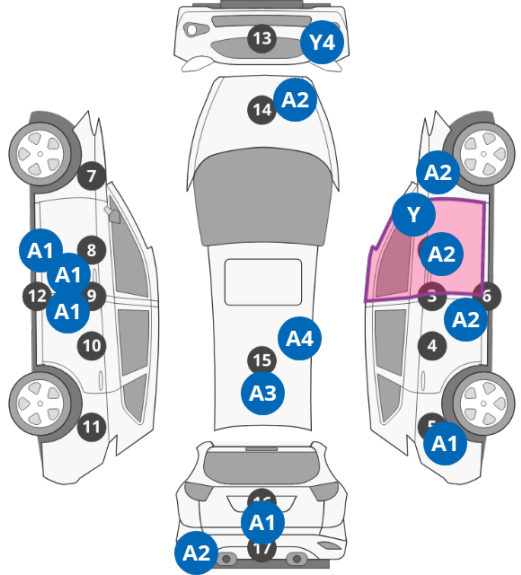
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	285.3	275	280	301
2	Boot Lid	107.0	100	115	106
3	Roof	186.2	191	196	173/185
4	Left Front Fender	224.3	239	195	239
5	Left Front Door	205.3	238	187	191
6	Center Panel Left				
7	Left Rear Door	249.6	283	226	240
8	Left Back Panel	267.3	326	224	252
9	Right Front Fender	235.3	269	223	214
10	Right Front Door	512.0	248	225	1,063
11	Center Panel Right				
12	Right Rear Door	226.6	237	213	230
13	Right Back Panel	257.6	248	277	248

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Cut, Crack - Small / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Crack - Cracks / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof Spoiler, Molding - Scratch - Medium / Roof - Scratch - Large / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, 1key, no warranty booklet, no spare tire, no jack and tools, scratches on headlight, Crack on taillight, abnormal vibration on vehicle, possible flooding, stain on body,warning lamp issue,foul smell</p>