

General Information

Date & Time: 14, Jan, 2026 15:58

Make	Isuzu	Model	Crosswind
YOM	2015	Odo Meter Reading	142,064
Registration No.	AMA8917	Chassis No.	PABTBR54FF2083312
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Beige		

Body / Panel Condition



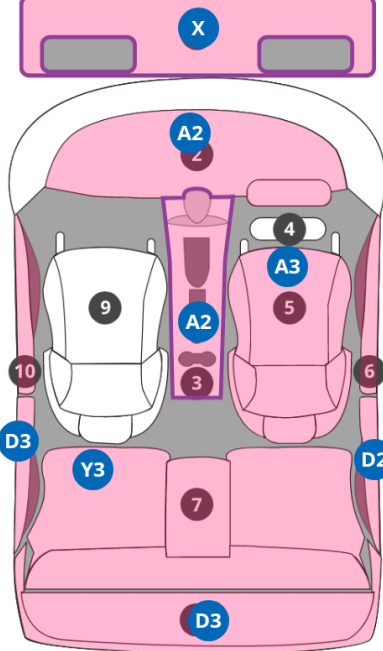
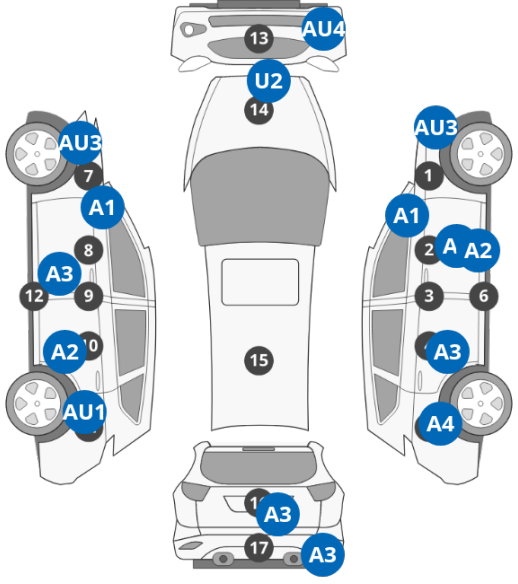
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	204.3	205	181	227
2	Boot Lid	101.5	115	89	101
3	Roof	118.4	129	132	116/97
4	Left Front Fender	121.6	134	119	112
5	Left Front Door	126.6	135	115	130
6	Center Panel Left				
7	Left Rear Door	134.6	145	114	145
8	Left Back Panel	136.0	148	112	148
9	Right Front Fender	130.6	131	129	132
10	Right Front Door	136.0	134	105	169
11	Center Panel Right				
12	Right Rear Door	154.6	183	132	149
13	Right Back Panel	137.0	123	141	147

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Sunvisor, Sunglass Holder - Missing - Yes / Display, Audio System - Missing - Yes / (R) Front Seat - Cut, Crack - Medium / Rear Seat - Grime - Medium / (L) Rear Trim - Loose, Deformed - Medium / (R) Rear Trim - Loose, Deformed - Small / Trunk Room - Loose, Deformed - Medium / Knobs - Worn, Peel, Crack - Small / Room Lamp - Missing - Yes / Steering Wheel - Worn, Peel, Crack - Small	Remarks Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch, Peeled - Minimal / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Small
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
With Lto plate, with warranty booklet, 2keys, with spare tire, no jack and tools, scratches on headlight and taillight, faded roof,aircon and radio issue