

## General Information

Date & Time: 15, Jan, 2026 14:00

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	106,339
<b>Registration No.</b>	NEW4076	<b>Chassis No.</b>	PA1B18F3844169256
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



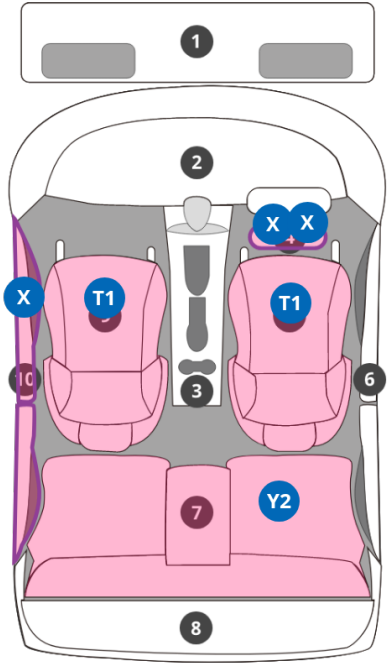
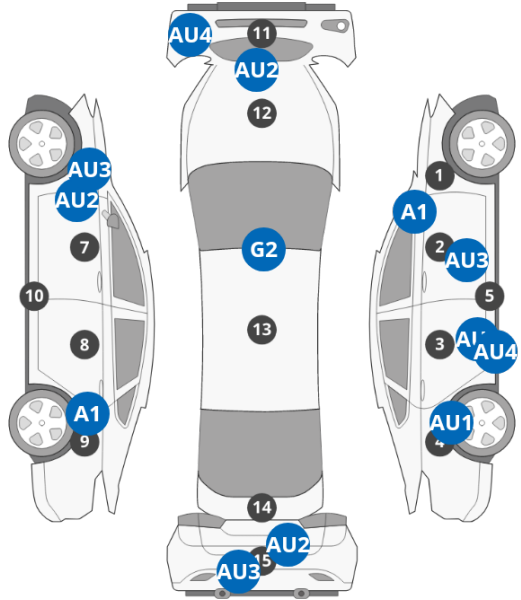
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	114	109	101
2	Boot Lid	110.6	113	103	116
3	Roof	96.0	106	91	86/101
4	Left Front Fender	92.4	89	95	93
5	Left Front Door	99.4	95	103	100
6	Center Panel Left				
7	Left Rear Door	105.0	101	104	110
8	Left Back Panel	119.0	130	123	104
9	Right Front Fender	98.8	105	98	93
10	Right Front Door	101.7	107	97	101
11	Center Panel Right				
12	Right Rear Door	106.1	100	106	113
13	Right Back Panel	105.3	108	101	107

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Cigarette Burns - Burnt Minimal / (L) Front Seat - Cigarette Burns - Burnt Minimal / Rear Seat - Grime - Small / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Trim - Missing - Yes</p>	<p><b>Remarks</b> (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Windshield - Scratch, Stone chip - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>No Lto plate, 1key, no warranty booklet, no spare tire, no jack and tools, scratches on headlight and taillight, hood stand issue, bumper logo missing, side mirror button missing</p>