

## General Information

Date & Time: 16, Jan, 2026 12:36

<b>Make</b>	Toyota	<b>Model</b>	Hilux Tamaraw
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	8,146
<b>Registration No.</b>	NKS2854	<b>Chassis No.</b>	PAHACACA2S6426476
<b>CC</b>	2.4	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Utility Vehicle
<b>Colour</b>	White		

## Body / Panel Condition



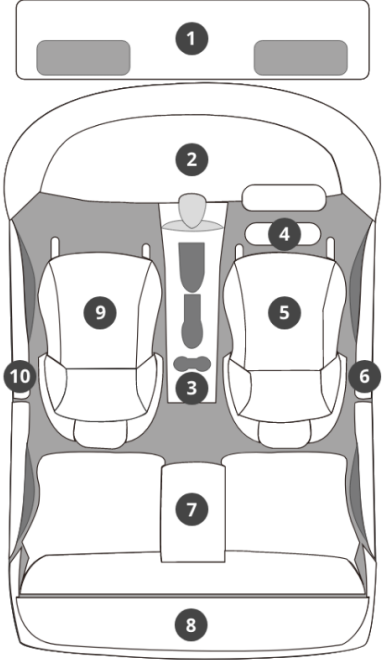
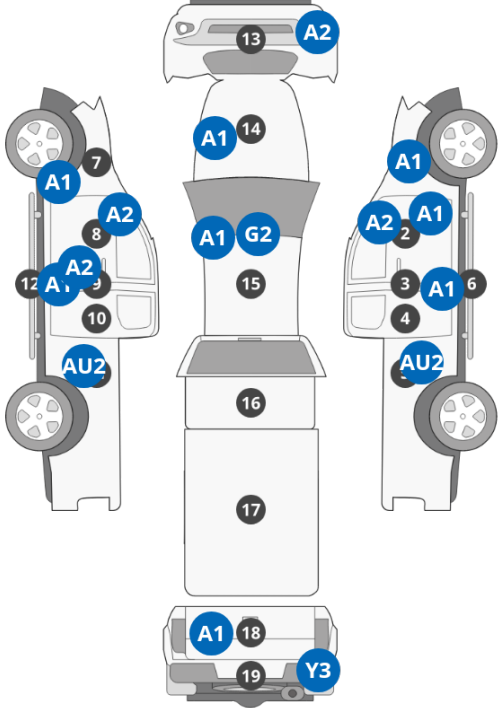
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	108	107	106
2	Boot Lid	51.8	62	50	44
3	Roof	114.0	117	128	103/108
4	Left Front Fender	105.5	99	105	113
5	Left Front Door	101.3	105	103	96
6	Center Panel Left	96.3	100	100	89
7	Left Rear Door				
8	Left Back Panel	61.3	47	81	56
9	Right Front Fender	104.9	108	107	100
10	Right Front Door	103.0	100	103	106
11	Center Panel Right	112.0	115	121	100
12	Right Rear Door				
13	Right Back Panel	65.5	52	86	59

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-size: 24px; float: right;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-size: 24px; float: right;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch &amp; Dent - Small / Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Side Gate - Scratch &amp; Dent - Small / (L) Center Panel - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Front Windshield - Scratch, Stone chip - Small / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="color: red; font-size: 24px; float: right;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-size: 24px; float: right;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with Warranty Booklet, Jack and Tools, with Sparetire and LTO Plate, Scratches and cracked Tail Light, park light issue</p>