

General Information

Date & Time: 17, Jan, 2026 11:16

Make	Toyota	Model	Rush
YOM	2023	Odo Meter Reading	109,213
Registration No.	NIK2485	Chassis No.	MHKE8FF3PPK054795
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



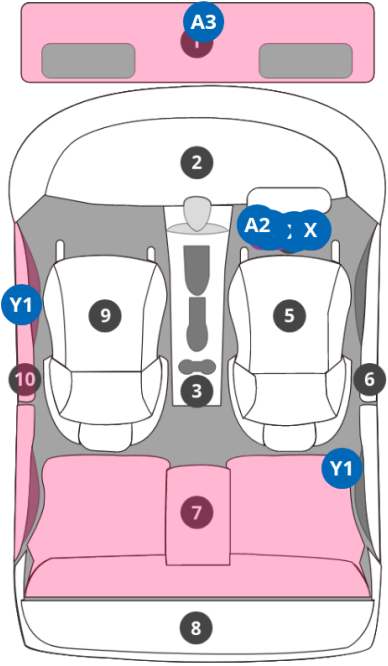
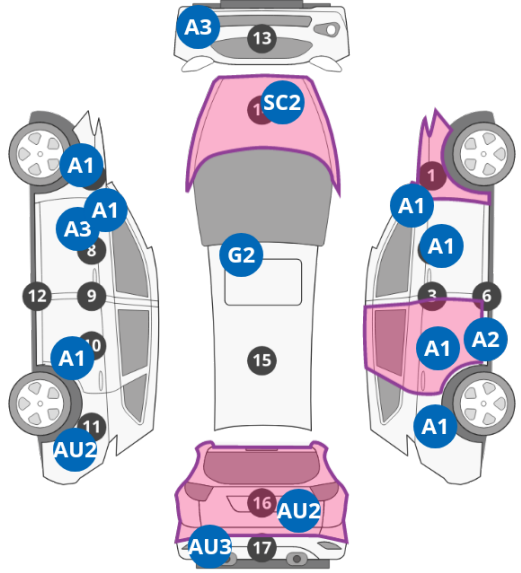
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	169.0	183	186	138
2	Boot Lid	483.3	1,219	123	108
3	Roof	90.9	91	91	92/90
4	Left Front Fender	98.9	99	98	100
5	Left Front Door	94.0	92	102	88
6	Center Panel Left				
7	Left Rear Door	96.1	98	93	97
8	Left Back Panel	90.2	92	87	92
9	Right Front Fender	473.0	175	804	440
10	Right Front Door	96.7	99	91	100
11	Center Panel Right				
12	Right Rear Door	174.0	121	130	271
13	Right Back Panel	97.5	99	94	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Cut, Crack - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / Carpet - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Front Windshield - Scratch, Stone chip - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Rust, Corrosion - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Turn Signal, Hazard Flasher - Issue - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare and jack, 2keys, no warranty booklet, no tools, scratches on headlights, Crack taillight</p>