

## General Information

Date & Time: 19, Jan, 2026 08:35

<b>Make</b>	Mitsubishi	<b>Model</b>	Xpander
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	127,416
<b>Registration No.</b>	GAT6057	<b>Chassis No.</b>	MK2LNNC1WMN000739
<b>CC</b>	1.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Wagon
<b>Colour</b>	Gray		

## Body / Panel Condition



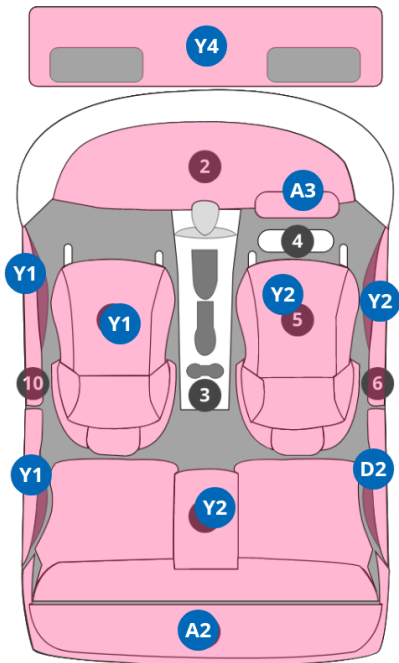
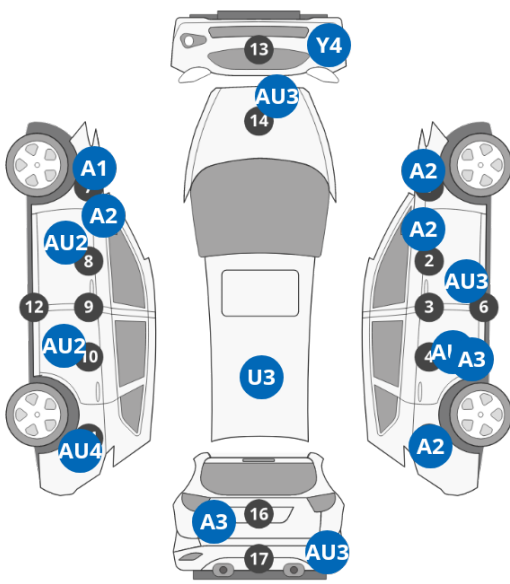
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.7	91	87	104
2	Boot Lid	86.1	84	91	83
3	Roof	88.3	97	86	86/84
4	Left Front Fender	82.3	88	83	76
5	Left Front Door	87.7	88	90	85
6	Center Panel Left				
7	Left Rear Door	89.1	86	92	89
8	Left Back Panel	96.3	100	88	101
9	Right Front Fender	77.4	81	81	71
10	Right Front Door	83.5	86	84	81
11	Center Panel Right				
12	Right Rear Door	79.7	81	79	80
13	Right Back Panel	89.3	96	84	88

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / Ceiling - Grime - Large / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Crinkle - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Seat - Grime - Minimal</p>	<p><b>Remarks</b> (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch &amp; Dent - Medium / Roof - Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Shift Shock - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/No warranty booklet/No reverse camera/right side headlight damage/No fog light/plate light issue/No jack and tools/engine under cover damage/left side front door issue</p>